

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report Jan. 9th. 22. When handed in at Local Office Jan. 23rd. 22. Port of VANCOUVER, B. C.

No. in Survey held at Port of Vancouver, B. C. & Date, First Survey 16, Sept. Last Survey 30th. Dec. 1921.
Reg. Book. Victoria, B. C. (No. of Visits 35.)11294, on the ~~Wood, Iron or Steel~~ S. S. "CANADIAN IMPORTER",

Master G. McConachy,

TONNAGE:-

Built at Vancouver, B. C.

By whom J. Coughlan & Sons Ltd.,

When 1920.

YEAR.

MONTH.

GROSS 5465.

Owners Canadian Government Merchant Marine Ltd., Port belonging to Montreal.

UNDER DK. 4899.

NET 3400.

Owners' Address As recorded.

(if not already recorded in Appendix to Register Book).

Surveyed Afloat or in Dry Dock? both. Name of Dock Government Dock, Victoria, B. C. Destined Voyage Australia.

WB=CellDBorDBa feet; uE&B feet; total capacity tons. FPT tons; APT tons; MT feet tons.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

N.B.—All alterations in the existing records should be underlined.

If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

Last Report, No. 890 Port Vcr

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Years Assigned Assigned expired.	Machinery and Boiler Surveys (including date of N.B., if any).
*100 A1, 2-20,		*L.M.C 2-20,
		CL

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

Society's Freeboard (if assigned) as painted on Ship and now verified ft. ins.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined? attached hereto. Was a damage report made by anyone else? If so, by whom? Underwriters.

REPAIRS, OR EXAMINATION AS PER RULE, FOR DAMAGE:- Stated to have been sustained through the flooding of No. 2 Hold, and Engine & Boiler Spaces in August and September 1921, while on a voyage from British Columbia Ports to Australia. (See Damage Report hereto attached) have examined the vessel in drydock, and afloat, and the following overhauling, and repairs have now been effected.

Shell Plating, riveting, and caulking examined, and tested.

Double bottom tanks tested with water to height of upper deck, and found sound. Boiler Room bulkhead tested by flooding the bilges on port and starboard sides forward of same, and by hose pressure from that point up. Watertight doors on boiler room bulkhead examined the starboard door found in good working order, the Port door was found tight in slides when nearly closed, it was found necessary to submit door to blows in addition to pressure by controll shaft, both these

SUMMARY OF DAMAGE REPAIRS:-	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:-
Reviewed ...								
Removed and Faired or Repaired ...								
Faired or Repaired in place ...								
PRESENT CONDITION OF THE	Stringers	Good.	Dbing. Plates under Sounding Pipes	Good.	Copper, or Y.M. of Wood Vessels			
Decks	Inner Bottom Plating	Yes as far as possible.	Engine Room Skylights	"	(State if on Felt.)			
Caulking of Decks	State if Tanks have been examined inside		Coal Bunkers, Open'gs, Lids, &c.	"	When put on, Month			
Waterways	State if Tanks now tested	Yes all D.B.	Scuppers	"	Boats			
Coamings	Bulkheads	Good.	Cargo Hatchways	"	Masts, Yards, &c.			
Beams & Fastenings	Ceiling	"	Hatches	"	Condition, how ascertained from rigging.			
Outside Plating	Cement or Asphalt	Cement.	Planking of Wood Vessels	"	(State if wedges removed)			
Caulking of ditto	Rudder	Good.	Caulking	ditto.	Sails			
Rivets	Steering gear and its connections	"	Treenails	ditto.	Equipment letter	Y		
Breasthooks & Crutches	Windlass	"	Breasthooks & Stemson	ditto.	Anchors, No. of	3B. 1S. 1K.		
Transoms	Have Pumps now been examined and found efficient?	Yes.	Transoms, Pointers, & Crutches ditto		Cables (State if now ranged)	YES.		
Frames	Have Sluice Valves now been examined and found efficient?	-	Timbers of Frame at openings ditto		" length	270	size 3/16	
Reverse Frames	Have Watertight Doors now been examined and found efficient?	Yes.	Ditto ditto at other places ditto		" Rule length	270	size 3/16	
Floors			Stringers, Clamps & Shells	ditto.	Hawser & Warps	Good.		
Keelsons			Salting	ditto.	Standing & Running Rigging	"		
			(State if examined.)					

General Observations, Opinion as to Class, Recommendation, &c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:- "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,15," or "to remain as classed and to have record of survey, 1,15, and the notations of ss No. 1-15 and pND15, &c."

This vessel is now in efficient condition, and eligible in our opinion to remain as classed, and have fresh record of survey 12-21.

Survey Fee (per Section 28) ...

Special Damage or Repair Fee (if any) ...

Travelling Expenses (if chargeable) ...

Second Surveyor's Fee (if any) ...

Fees applied for

Received by me

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Character Assigned

See Minute
on Feb 4 1922Lloyd's Register
Foundation

11335-0136 1/2

13.—If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damaged as to spread the ink or to cause it to show through to the other side

The air, and sound pipes examined and found in good order.

Two scupper pipes from Bridge deck on starboard and two on Port side removed. the openings through shell plating, (16" above load line) plated over, also the openings in deck and scuppers cut through Bridge deck gunwale.

When Anchors or Cables are supplied, the particulars are to be reported in the following form:—

ANCHORS.																
Number of Certificate.	Anchors.*	WEIGHT, EX. STOCK.			WEIGHT OF STOCK.			TEST, PER CERTIFICATE.			WEIGHT REQUIRED by TABLE 30 or 31.			Description of Anchor.	Makers.	Where and when tested and Superintendent.
		Cwts.	qrs.	lbs.	Cwts.	qrs.	lbs.	Tons.	Cwts.	qrs.	lbs.	Cwts.	qrs.			
	1st Bower															
	2nd "															
	3rd "															
	Collective Weight.															
	Stream															
	Kedge															

* When a bower anchor is supplied it must be clearly stated that it is a bower anchor.

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

[illegible]

ort of VANCOUVER? B. C.

on the **"CANADIAN IMPORTER"**

All storm valves and guards in way of soil and scupper pipes overhauled.
Water was pumped from all double bottom tanks, and the ballast pumping arrangement found in good order.

The engine room casing above Bridge deck on Port side, also the skylight found buckled, and damaged (stated due to a beacon having been lighted on same) now made fair, and in good order.

Vessel's bottom and rudder cleaned and painted.

13