

Nyggjæberg

Thorshavn L.A.
8/5-0.

The class of this vessel was expunged with a red line 1.40 on account of reported defects in the hull.

A complete survey of the machinery was held 3.39 and with a view to re-classification the boiler survey has now been held & the machinery examined under working conditions.

A number of screw stays in the boiler have been renewed. At the same time however it was found that some of the longitudinal stays were wasted and these have been built-up by means of electric welding. A repair of this nature is contrary to the Rules.

It is submitted that before reclassification can be considered the Surveyor should be informed that electric welding of stays is not permitted by the Rules and arrangements should be made for any of the stays so repaired to be renewed.

L.F.
8/4/02.



© 2021

Lloyd's Register
Foundation

W1347-0003