

Port of New York

August 18, 1933 19

REPORT ON MASTS, SPARS, AND RIGGING.

Dear sirs:

Having, in accordance with your instructions, examined the Masts, Spars, Iron Work of same, and Rigging, of the (Name of Vessel) S. S. Eastern Glen."

on the (Date of examination) August 12, 1933 19

I have to report that I found after stripping service the same in good ~~condi~~ condition with the following exceptions:

Fore topmast backstays port & starboard sides badly rusted and deteriorated.

Sampson Post stay port side abreast of #3 hatch badly rusted and deteriorated.

Funnel guy #2 Port badly rusted and deteriorated.

Main topmast stay leading aft to poop deck is undersize.

Main topmast (wood) badly decayed at heel where telescoped in Mainmast head.

Recommend:

Above mentioned stays be renewed (5 stays). ^{top} Mainmast be lifted out for further examination. All standing rigging & stays be thoroughly cleansed, opened up, ^{oiled} reserated & reseized, after applying coat of preservative.

Robert W. Edgell

Fee \$20.- :

To the Surveyors,
Lloyd's Register of Shipping,

W150-0136



© 2020

Lloyd's Register
Foundation