

**LLOYD'S REGISTER OF SHIPPING,**  
425 KING STREET

Rpt.No.U-28.

**JACKSONVILLE, FLA.**

10th November 1921.

This is to certify that the undersigned surveyor at this port, did, at the request of Mr. Henry Black of the Salvage Association, London; of 68 Broad Street, New York City, survey the Oscar Daniels Co's Hull No.12 ("BYRON D. BENSON") for the purpose of ascertaining the nature and extent of the damage stated to have been caused by flood on the 25th Oct. 1921.

On examination of the vessel and equipment and material in the yard

- FOUND -

- RECOMMENDED -

Only damage on vessel was loss To be replaced.  
of ship's bell.

Smoke stack badly damaged and out of shape. Cape tern. Inner stack cut adrift and both sections repaired.

Stokohold and two engine room vents badly damaged.	To be repaired.
---	-----------------

Two lifeboats badly indented, To be repaired.  
tanks damaged and bottom boards  
washed away.

Electric whistle control and mechanical telegraph damaged by water.	To be repaired.
---	-----------------

Electric fixtures and wiring To be cleaned.  
damages by salt water.

Ropes and canvas damaged by water.	To be dried and recoiled.
------------------------------------	---------------------------

Several hundred valves damaged. To be cleaned & overhauled.  
by salt water.

Bright parts of main engine  
damaged by salt water. Also  
auxiliary parts.

All sheet iron damaged by salt water.

Lloyd's Register  
Foundation

W150-0193 1/2  
W150-0193 1/2



2.

Rpt.No.U-28 (contd)

Small galvanized tanks damaged. Repair & retest.

Joiner work damaged. Screen doors warped and finish on furniture destroyed. To be cleaned and refinished. Moulding of screen doors renew.

Electric conduits damaged. Clean & rethread.

1500 feet of steel tubing for interior communication damaged. To be replaced.

10 Electric bells damaged. To be replaced.

Paint shop was washed away and the following material is claimed.

1100 Gals. Linseed Oil.

900 lbs. White Lead.

1 Bbl. Hold Red; Turpentine; Red Lead; Anti Corrosive; Anti Fouling.

The following material was used in cleaning up material.

1 Bbl. Cylinder Oil; Red Oil; Gasoline; Kerosene.

The above repairs and renewals will cost approximately \$5000.00 allowing 50% overhead on labor which figure builders advise they are allowed by policy.

*J. Hugh Boyle*

FEE & EXPENSES. \$58.05

No. No. Round Dk. Inches. Size in Ship.

Center

Inches. In Ship, in

3 1/2

3 1/2

3 1/2

3

8

3 1/2

6x16

6x6

57

6 x

60 x

6 x



© 2020

Lloyd's Register Foundation

W150-01932 1/2

Spacing  
BEAMS, Bridge Deck, Angle, Bulb Angle, Plate,  
Tee Bulb or Channel

Angle on ditto

Tie Plates