

## REPORT OF SURVEY FOR REPAIRS, &amp;c.

Date of writing Report 15. 1. 1940 When handed in at Local Office 15. 1. 1940 Port of Copenhagen

No. in Survey held at Naks Kov. Date, First Survey 9 - 1 - 40 Last Survey 12 - 1 - 1940  
Reg. Book. (No. of Visits two.)

27/84 on the Wood, Iron or Steel Twin Sc. M.S. CHILE

TONNAGE:-

GROSS 6956

UNDER DECK 5045

NET 4433

Built at Copenhagen

By whom Akt. Burmeister &amp; Wain

When 1915

MONTH 12

Owners A/S Det. Skasiatske Kompagni

Owners' Address

(if not already recorded in Appendix to Register Book).

Managers

Port belonging to Copenhagen

Surveyed Afloat or in Dry Dock 99 on pontoon Name of Dock Naks Kov Skibsværft. Destined Voyage

Cell D Bor DBa feet; u E & B feet; f feet  
total capacity tons. FPT tons; APT tons; MT feet tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

Last Report, No. 42 Port SAB

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules and items remaining to complete the Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined offered to Owners, not req.

Was a damage report made by anyone else? If so, by whom? Insurance surveyor.

REPAIRS, OR EXAMINATION AS PER RULE, FOR

Damage stated due to striking the dock gate 14-39. 2) Grounding at River Maas 6/2-39.

how done: vessel placed on pontoon, bottom, sides &amp; rudder cleaned, examined and recoated, and the following damage repairs carried out:

S.S. One plate (K15) faired in place.

P.S. One plate (K14) removed, faired &amp; refitted. One plate (K15) &amp; one stringer plate faired in place.

Sub. oil db. tank. A few started rivets in tank top removed and a few leaky shell rivets made good by caulking and elec. welding. Tank tested on completion &amp; found satisfactory.

Decks, hatches, covers, casing, houses &amp; vents examined.

H. S.

SUMMARY OF DAMAGE REPAIRS:-

	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:-
Renewed								
Removed and Faired or Repaired	1							
Faired or Repaired in place	2						1	

PRESENT CONDITION OF THE

Decks	Good	Bulkheads	partly good	Engine Room Skylights	Good	Copper, or Y.M.	✓
Plating of Decks	✓	Ceiling	✓	Coal Bunkers, Openings, Covers, &c.	✓	(State if on Fett.)	✓
Stairways	✓	Cement or Asphalt	✓	Oil Bunkers	✓	When fitted, Month	Year
Rails & Fastenings	partly good	Rudder	Good	Scuppers	Good	Boats	Good
Outside Plating	✓	Steering gear and its connections	✓	Cargo Hatchways	✓	Masts, Yards, &c.	✓
" " in way of sidelights	✓	Windlass	✓	Hatches	✓	Condition, how ascertained	from deck
Transverse Frames	partly good	Have pumps been examined and found efficient?	no	Planking	✓	(State if wedges removed)	at ✓
Longitudinals	✓	Have Sluice Valves been examined and found efficient?	✓	Caulking	✓	Equipment letter	3B. 15
Transverses	✓	Have Watertight Doors been examined and found efficient?	no	Treenails	✓	Anchors, No. of	3B. 15
Covers	✓	Have Ventilators and their Coamings been examined and found efficient?	yes!	Breasthooks & Stemson	✓	Cables (State if now ranged)	no
Belsons	✓	Air and Sounding Pipes	Good	Transoms, Pointers & Crutches	✓	" length	slated to mean diamr.
Rings	✓	Doubling Plates under Sounding Pipes	✓	Timbers of Frame at openings	✓	(on board)	✓
Inner Bottom Plating	✓			" " at other places	✓	" Rule length	in complete size
Have the Tanks been examined internally?	sub. oil			Stringers, Clamps & Shelves	✓	Chain Locker	✓
Have the Tanks been tested?	no			Salting	(State if examined.)	Hawsers & Warps	efficient
						Standing and Running Rigging	✓
						Sails	✓

General Observations, Opinion as to Class, Recommendation, &amp;c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

This vessel is eligible in my opinion to remain as classed and to have record of survey 1,40.

Survey Fee (per Section 20) £ 17. 1. 19. 40

Special Damage or Repair Fee (if any) £ 125. 00

Travelling Expenses (if chargeable) £ 68. 00

Second Surveyor's Fee (if any) £

Fees applied for,

Received by me,

H. D. Andersen

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Character Assigned

TUE. 13 FEB 1940

See Lpn. 11096



© 2019

Lloyd's Register Foundation

W 155-0095