

by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

'S NAME..... CHARLWOOD..... Rpt..... Off..... No. 54091.....

marks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

The 2nd S.S. No. 3, due 7.39, has been commenced by the examination of the windlass.

A notation of "Examined 4.41", valid for 12 months, has been assigned.

Indented No. 2 sheerstrake plate (s.s) requires to be dealt with at the first convenient opportunity.

The steelwork generally in holds and fore peak tank requires scaling and coating.

The deck plating in forward well and at fore end of quarter deck (p & s), where worn, and a wasted frame behind donkey boiler require to be dealt with at the first opportunity.

The CARDIFF Surveyors report the vessel placed in dry dock, bottom coated, and on account of damage through ranging against quay wall shell plates E.6 & 7 (s.s) found indented and frames in way buckled.

The riveting and caulking has been overhauled, and the Surveyors recommend repairs at the first convenient opportunity.

On removal of cement chocks the main frames on starboard side No. 2 hold in way of above damage were found considerably wasted and holed in places. These frames have now been fitted with back straps and reversed angles.

Minor repairs effected.

The outstanding items as above remain efficient.

It is submitted action be deferred.

(DOCKING DATE 11.41)

Insert in S.R.L: - Rps as recommended.  
Framing in way of bilge cement chocks to specially examine at next General Examination.

The Certificate of Classification to be endorsed "Cargo battens not fitted" and the same notation to be printed in the Register Book.



© 2019

Lloyd's Register  
Foundation

W156-0085