

CONDITION. Vessel placed in drydock, shell plating+rudder cleaned and examined
before commencing and vessel delivered

2m, 11.38.

2

7 JAN 1943

Sent to Chief Surveyors

Received from Chief Surveyors

VESSEL'S NAME

"CERAMIC"

Report

N. Yk.
Liv.

42680
No. 118856

For the CHIEF SHIP SURVEYOR ~~and CHIEF ENGINEER SURVEYOR.~~

(In cases which have to be submitted to the Classing Committee "the endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/32.)

(3RD. No. 1 SURVEY PARTLY HELD) DAMAGE & ALTERATIONS

When due

8.40


Examined 5.42" 12 months.

Portion of Survey held, &c.

Examination of anchors & cables, Nos. 1, 2, 3, 5, 9, 10, 11 & 12 D.B.
Tanks and the tunnel side domestic F.W. tanks (s.s.) (7.40).

Subject to permanent repairs to set up bottom plating & floors etc. in way (p & s) at the first convenient opportunity, to No. 7 D.B. tank top (p & s) at the first opportunity (No. 7 boiler room D.B. tank top not to be subjected to pressure until repaired), to after tank end of No. 5 D.B. tank (p & s), to floors in Nos. 11 & 12 D.B. tanks, to turning passage plating, to (buckled & distorted) sheerstrake plate (s.s. amids.) and upper & 'tween deck plating (s.s.f.) at the first opportunity and to (a bower anchor and 45 fathoms of chain cable being supplied).

(Docking date)
10.42.

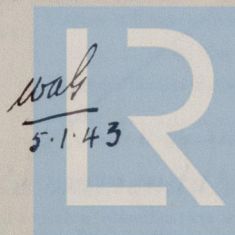

© 2020

S.S. Part Held.

Lloyd's Register
Foundation

W157-0054

is vessel so far as now seen is in an efficient condition, and in our opinion is eligible to re