

Glasgow
February 1911

William Watt


Mr. Fitzpatrick, the Owners' Representative, visit on the 14th December 1910, and subsequent dates, the Y.S.S. "Sand Grouse", 2061 tons gross, of Lagos, whilst she was in dry dock at the Yard of Messrs John Steamer & Sons Ltd. Scotstoun, for the purpose of ascertaining the nature and extent of the damage stated to have been sustained by the vessel grounding on the bar at Lagos on the 28th September 1910.

On examination found
Keel plate no. 35 indented
Shell starboard side. -

Twenty two (22) plates badly
buckled or broken viz. -
A2, A3, A19, B3, B16, C3, C16, C17.

Recommended.
To remove, repair, repair.

To be renewed.

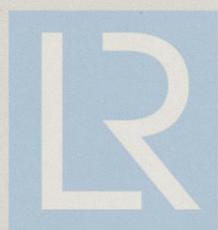

© 2021

Lloyd's Register
Foundation

W1581-0050 4

D16, E9, E10, E11, E12, E13, E14, E15,

F10, F11, F12, F13, F14, F15.

Four plates indented viz. - To be removed, fairied, and
A6, A17, A18, B2, B17, B19 doubling, replaced.

A4, D4, D18, D19.

Four (4) plates slightly indented To be fairied in place.
viz. - C12, D3, D13, D14.

Left Port side. -

Five (5) plates badly buckled To be renewed.

- broken viz. - A2, A15, B16, C15, D4.

Five (5) plates indented viz. - To be removed, fairied, and
replaced.
A6, A17, A18, B17, D13, D16.

One (1) plate slightly indented viz. C12 To be fairied in place.

etc. - All plates numbered from aft. Doubling plate to be fitted over A19, P. & S. sides.

Both well sides. - one plate To be fairied in place.
each side indented.

Starboard side.

Sixteen (16) frames badly buckled or broken. To be croppped, and part renewed.

Ninety-one (91) frames slightly indented. To be fairied in place.

Forward frames Starboard side.

Sixteen (16) forward frames slightly buckled. To be fairied in place.

Floor, Starboard side. -

Eighteen (18) floor slightly buckled. To be fairied in place.

The floor buckled.

The bulkhead floor badly buckled. To be removed, fairied, replaced.

To be part renewed.

lacing of twelve (12) frames
frames on Port side, and
eleven (11) on Starboard side
bent or broken

Rivets to be cut out
and renewed.

udder to be lifted for examination and
wherever replaced, packing in deck gland
to be renewed; Screen bulkhead at after end
engine room where buckled to be cut adrift,
fairied, & riveted, & pillars in way of same to be
fairied and riveted; One bent pillar in
way of bearing block on Starboard side to be
removed, fairied, & riveted; bedding across
a few to be part renewed; two broken hawse
holes to be renewed; starboard bow roller
fairlead to be lifted, rebedded, & refastened;
about ten feet of starboard bedding amidships
to be renewed, and face bar on same to be
refastened; Steering engine to be overhauled,
steering chains renewed; Side-walk
stanchions to be renewed and twelve to
be fairied and refastened; about 150 ft. of
sidewalk rods to be renewed; two deck bilges
and one fairlead to be renewed; all riveting
in way of damage to be tested and all
defective rivets to be cut out and renewed;
all broken and defective cement in bottom
be cut out and renewed; all new work
receive two coats of approved paint, and
stem and rudder to be cleaned & painted;



4.

to be ranged for examination, and to
be cleaned as required, cleaned and replaced.

The recommendations are made to place
several in as good and efficient condition
before the damage was sustained.

15-15-0.

1. 12.
6 tott - 3 /.

M. Watt



© 2021

Lloyd's Register
Foundation

W1581-0050 ⁴/₄