

DCW

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

19 JAN 1949

VESSEL'S NAME SAN ZOTICO

REPORT

Bom.

No. 8909

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/42.)

The validity of the present "Examined" notation expired 9.48.

The date of the last Special Survey is No. 1 - 36.

The Owners' proposal to continue classification on the basis of yearly General Examinations was agreed to by the Committee in 8.47.

For conditions of class see previous endorsement.

The BOMBAY Surveyor reports (11.48) the vessel placed in dry dock, bottom coated and a GENERAL EXAMINATION held.

The vessel now specially examined on account of grounding and no damage found.

Wear and tear repairs effected to shell, deck and bulkhead plates, floors and minor items.

The buckled forecastle deck plating, as above, now dealt with.

The indented shell plating, set down trunk deck plating, as above, now specially examined and continues efficient.

The E.W. repairs of the stern frame solepiece also examined and found to continue efficient.

IT IS SUBMITTED the vessel is eligible to remain as classed, with record of docking 11.48, subject to permanent repairs to indented shell plating, etc. (p & s) at the first convenient opportunity, to set down trunk deck plating at the first opportunity, to stern frame solepiece (E.W. 7.45) being specially examined at the next drydocking, and to (a bower anchor and 15 fathoms of chain cable being supplied), but without other condition: and to have NOTATION of "Examined 11.48" valid for 12 months assigned as recommended.

11.48 Bom. ) Subject  
"Examined 11.48" ) Without

W.O.T.  
6.1.49.

Solepiece  
EW repairs



© 2019

Lloyd's Register  
Foundation

W1654 - 0013