

COPY.

Lloyd's Register of Shipping.



Port CAPE TOWN.

9th July, 1942.

This is to Certify that

JANNIS ABRAHAM VAN LARE

the undersigned Surveyor to this Society did at the request of the Master and Messrs. Wm. Anderson & Co. Ltd., Agents, Survey the S.S. "HATARANA" of London, 7,522 tons gross, whilst afloat at Cape Town on the 2nd July, 1942, and subsequently for the purpose of ascertaining the nature and extent of the damage stated to have been sustained through heavy weather on the 27th and 28th June 1942 whilst on a voyage from Durban to Cape Town.

On examination the undersigned found the following damage and made recommendations for repairs as under:-

FOUND.

RECOMMENDED.

- | | |
|---|--|
| 1. One awning stanchion on fore-castle head bent and adrift. | To be faired and refastened. |
| 2. Windlass steam pipe casing on fore-castle head buckled and adrift. | To be faired and refastened. |
| 3. Wood deck sheathing in way of awning stanchion and steam pipe casing splintered and started. | To be renewed. |
| 4. Cement deck covering on fore-castle head broken in one place. | To be renewed. |
| 5. Hand rails after end of fore-castle head bent and adrift. | To be faired and repaired as necessary and refastened. |
| 6. Fore-castle head breakwater movable sections washed over-board, slides of same damaged. | Movable section to be renewed slides to be repaired. |
| 7. Fore-castle galley funnel badly buckled and adrift. | To be renewed. |

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that :-

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error or default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Agents of the Society."

Lloyd's Register of Shipping

Report 10;

Page 2.

S.S. "HATARANA".

FOUND.

RECOMMENDED.

- | | |
|---|---|
| 8. Outboard flange of starboard hawse pipe leaking. | To be welded off. |
| 9. Three glass of forecastle scuttles fractured. | To be renewed. |
| 10. 6 Hatch locking bars bent. | To be faired and repaired as necessary. |
| 11. Rudder trunk in after peak space holed. | Welded patches to be fitted. |
| 12. No. 5 boat ladder washed overboard. | To be renewed. |
| 13. Windlass steam pipes on forecastle head twisted. | To be renewed. |
| 14. Lead suction pipe of main engine sanitary pump fractured. | To be repaired. |
| 15. Winch balance weight lever fractured. | To be renewed. |
| 16. Three winch drain cocks broken off. | To be renewed. |

The above repairs have now been efficiently carried out.

(Signed) J. A. VAN LARE.

SURVEYOR TO LLOYD'S REGISTER OF SHIPPING.

(Signed) J. A. VAN LARE.

Surveyor to Lloyd's Register.



© 2019

Lloyd's Register Foundation

W177-0050 (2/2)