

properly fastened, as required.
 The D.B. internally and externally its
 mountings and fittings and found or made
 good.

Adjusted all safety valves under steam to the
 working pressures. S.B. 17 B. washen 9-6 m/m P 9-6 m/m
 D.B. 6-5 m/m.

Repair carried out:

1 P cylinder bored fair new piston springs
 fitted.

A new general donkey pump 9 x 5 1/4 x 10" has
 been added with necessary pipe connections
 properly tested as required. The old Wren pump
 has been arranged to draw from ballast and
 bilge suction only. All auxiliaries
 thoroughly overhauled.

All main steam pipes, 7 pieces superheaters
 and connections tested to 540 lbs, 4 pipes renewed
 new cast steel safety valve boxes tested as
 required fitted.

Electric installation thoroughly overhauled.
 Donkey boiler removed from ship, a number
 of rivets in furnace connection to end plate
 renewed, all longitudinal stays and a
 number of cross stays renewed. Boiler refitted
 to 270 lbs and found good and tight.
 Boiler refitted on board. Boiler seats ex. had
 found or made good.

A. Priolo

Machinery & donkey boiler surveyed
 & 2 new main boilers fitted. Etc.

N.B. - If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damaged as to spread the ink, or to cause it to show through to the other side.

It is submitted that
 this vessel is eligible for
 THE RECORD. + LMC 12.22.
 + NB 12.22.
 5/12.22.
 GS 1/13. HS 4598.
 324 NHP.

W.D.
 28/12/22

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THE MARGIN.