

COPY.

Lloyd's Register of Shipping.

GLASGOW REPORT No

62642

Port

GLASGOW

29th July, 1940.

This is to Certify that

A.J. BROWN,

the undersigned Surveyor to this Society did at the request of Messrs. David Rowan & Co., Ltd., attend on board the Steel Screw Steamer "MARINETTA E." whilst the vessel was lying afloat at Glasgow on the 26th June, 1940, and subsequently, for the purpose of ascertaining the nature and extent of the damage sustained through shortage of water in the starboard main boiler caused by the boiler having been inadvertently blown-down.

FOUND.

Starboard combustion chamber tube plate buckled to an extent of approximately $\frac{3}{8}$ " in way of bottom rows of tubes and saddle plate. A number of combustion chamber screw stays leaking and seams started.

In port and centre combustion chambers a number of stay and plain tubes leaking; a number of screw stays leaking and seams started.

RECOMMENDED.

Furnace to be removed for access and tube plate to be renewed in halves with seam vertical and welded in position. All tubes and breast stays to be renewed. All stay nuts to be removed and stays recaulked where necessary. Plate seams to be recaulked where necessary.

All tubes to be re-expanded (when this was done, the plain tube ends showed signs of punishment and all were recommended to be renewed). All stay nuts to be removed and stays recaulked where necessary. Plate seams to be recaulked where necessary.

On completion of repairs, boiler to be tested by hydraulic pressure to 388 lbs. per sq. inch.

Further recommended:- /

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

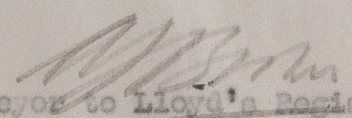
While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly performed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society.

Further recommended:-

That all disturbed parts removed for effecting the foregoing repairs be replaced in good condition and recoated as original.

The foregoing recommendations are made in order to place the boiler in as good condition as it was in before having sustained the damage in question.

PER:- 8 10 : 10 : -.


Surveyor to Lloyd's Register.



© 2019

Lloyd's Register
Foundation

W182-0108 2/2