

COPY.

Lloyd's Register of Shipping.



Port of PORT NATAL.

6th October, 1942.

This is to Certify that

DAVID ROSS INNES.

the undersigned Surveyor to this Society did at the request of

The Master, and Messrs. W. Dunn & Co., Agents, survey the S.S. "NURMAHAL" of London, 5419 tons gross, whilst afloat at Port Natal, on the 23rd September, 1942, and subsequently, for the purpose of ascertaining the nature and extent of the damage, stated to have been sustained in the Arabian Sea during a monsoon from the 23rd to 25th July, 1942.

On examination the undersigned found the following damage and made recommendations for repairs as under:-

<u>FOUND.</u>	<u>RECOMMENDED.</u>
1. Steam and exhaust pipes on Port side at No. 1 hatch distorted.	To be faired.
2. Pipe casing and brackets buckled and fractured at Nos. 1 and 2 hatches.	Casing to be faired and brackets renewed.
3. 3 hold ventilators fore deck washed overboard.	To be renewed.
4. Welding on grab rails of 2 lifeboats fractured.	To be re-welded.
5. One lifeboat shell plating fractured about 1' 6".	Welded covering plate to fit.
6. The shell plating of above 3 lifeboats slightly indented on Starboard sides.	To be faired.

The above repairs have been efficiently carried out.

(Signed) D. ROSS INNES.

Surveyor to Lloyd's Register
of Shipping.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that :-

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

If Stockless, state Mechanical Test