

W232-0043

3m.7.40.

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

13 APR 1942

VESSEL'S NAME "AGHIOS SPYRIDON" Rpt. NWC. No. 100,183.

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

The class of this vessel, 100 A1, was withdrawn at the Owners' request in June, 1936, and she was subsequently classed with the Germanischer Lloyd.

A notation of 'Examined L.R. 6.41 - 6 months' has been assigned.

For outstanding repairs to wasted parts and deficiency in equipment see previous endorsement.

The NEWCASTLE Surveyors report, 1.42, the vessel placed in dry dock, bottom coated and General Examination made. The half beams and girder in way of hatchway at the level of the 2nd tier of beams found worn, now dispensed with, in favour of side stringer fitted with face bars, as per approved plan attached.

The centre line bulkhead (worn) and pillars missing were also dealt with as per approved plan. The double bottom tank in way of machinery space is now divided by a cement cofferdam one framespace in length, and tank in way of the boilers made into a dry tank. Piping arrangements have been dealt with as necessary. The tank top, found worn, has been stiffened by intercostal girders (p. & s) and floors in way stiffened with angles.

Repairs effected to watertight bulkhead, casing, hatchways, and to some fractured shell plating. Shell plates B3, C4, 5 & 6(s.s.a.) found indented, but efficient and it is recommended these be dealt with at the Owners' convenience. (1)

A General Examination has been made and the Surveyors (2) recommend a notation of 'Examined L.R.1.42', valid for 12 months be assigned.

It is submitted recommendation be concurred in.

Insert in S.R.L.:- Examined L.R. 1.42 (12 months). Indented plating (1)

Delete from S.R.L.:-

Repairs to C.L. bulkhead, hold, beams and girders, tank top under boilers.

Amend in R.B.:-

2 tr B & deep framing
Cell DBa 104 u E & B 38' f 150' 748 to
Cell D Ba 104' u E 20' f 150' 692 tons.

2021
Lloyd's Register
Foundation
H. 3.42.