

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

22 MAR 1922

VESSEL'S NAME

At. S. S. Gyp.

Rpt.

NWC

No.

75318

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

Nature of Survey

DAMAGE.

Subject: *Intended plates to be built with at Owners convenience*

Damage through

grounding, ice & heavy weather

now repaired as follows:-

| | Plates | Frames | R. Frames | Floors | Beams | Str. Plates | Dk. Plates |
|--|-----------|--------------|-----------|-----------|-------|-------------|------------|
| Renewed | <i>12</i> | <i>16 ft</i> | | <i>3</i> | | | |
| Removed and faired or repaired..... | <i>26</i> | | | <i>5</i> | | | |
| Faired or repaired in place..... | <i>72</i> | <i>20</i> | <i>5</i> | <i>15</i> | | | |

Other items:-

Vessel examined in dry dock. Intercostals, tank side brackets, tank margin plates, bulwarks etc. Repairs as necessary & minor repairs effected. Bottom recoated.

Repairs No. 1 One tank top plate & the whole of the tank's boiler seating renewed.

It is submitted the vessel is worthy to remain as classed with

record of Survey *3-22* as recommended *without special condition**100 A.1**3.22 Shl. { without etc*

The Certificate of Classification, to be endorsed
"Cargo battens not fitted," and the same
notation to be printed in the Register Book.

Lloyd's Register
Foundation

W232-0063