

COPY.

Lloyd's Register of Shipping.



Port of SPLIT.

27th. November. 1935.

This is to Certify that

A.J. BROWN

the undersigned Surveyor to this Society did at the request of the Owners, attend on board the Steel Twin Screw Steamer "KUMANOVO" 1409 Gross Tons of Dubrovnik, whilst the vessel was in the floating dock at the Brodogradiliste "Split" on the 23rd. October, 1935, and subsequently, for the purpose of ascertaining the nature and extent of the damage to the vessel's machinery alleged sustained through the vessel striking the quay wall at Herceg Novi with her starboard side during a gale on the 19th. Sept. 1935. For further particulars, see Log Books.

FOUND

Starboard propeller blades badly distorted and torn and one broken.

Starboard thrust shoes found scored with indications of overheating.

L.P. ahead and astern guide plates found cracked and scored on faces.

L.P. and M.P. ahead guide slippers cracked through faces.

L.P. bottom end bearing scored with indications of overheating.

Steering engine starboard lead pulley broken. Replacement fitted after accident examined and found efficient for permanent service.

RECOMMENDED

Propeller to be renewed.

Shoes to be reinstalled.

Guide plates to be renewed.

Slippers to be renewed.

Bottom end bearing halves to be reinstalled.

Further recommended: that all removals for access be restored in good condition: that all renewed, repaired and disturbed parts be coated as original.

The above recommendations are made in order to place the machinery of the vessel in as good condition as it was in before having sustained the damage in question.

Fee Din. 3000
Late attendance Fee 580
Expenses 75

Business Surveyor - Lloyd's Register.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—
"While the Committee use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Committee nor the Society are under any circumstances whatever to be held responsible for inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default, or negligence of the Surveyors, or other Officers or Agents of the Society."