

8-JAN 1940

of Ship Surveyor

Received from Chief Ship Surveyor

AME "SAN GUISEPPE" Rpt. Rot. No 28715a

ks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement.—Extract from Sub-Committee's Report, 24/5/92.)

The class is subject to bottom damage forward and aft port side being permanently repaired at the first convenient opportunity.

The 2nd S.S. No. 2, due 12.38, has been partly held. The manhole doors to double bottom in holds require to be re-examined and overhauled, some repairs were required in the lower shelf bunkers and to the sloped casing etc.

Permanent repairs (on account of damage through grounding) are also required to bottom plating and framing etc., port and starboard.


The Rotterdam Surveyors now report the vessel placed in dry dock, bottom coated and Special Survey completed. Nothing has been done to the bottom damage (p.s.) nor to the indented bottom plating port and starboard sides, but these parts have been examined and found efficient. The manhole doors in holds which had previously been repaired have been specially examined and found satisfactory. The pocket and shelf bunkers have been cleaned and examined and renewals and repairs in way effected to deck plating, hatches, casings, bulkheads etc., and some minor repairs have been carried out.

It is submitted the vessel appears eligible to remain as classed with fresh record of survey 12.39 and notation S.S. No. 2, 39, subject as above and to indented bottom plating etc. (p. & s.) being permanently repaired at the first convenient opportunity.

3121 (1/2)

and to bottom plating etc (p. & s) being carried out.

WS-0121 (1/2)

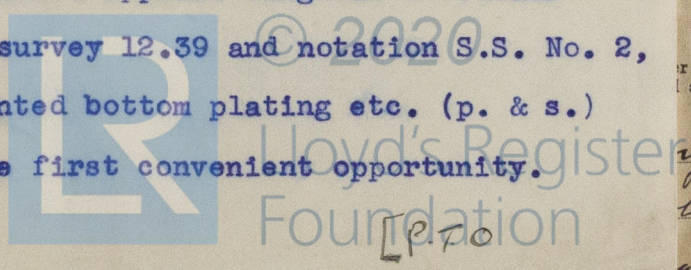

00 A1)
2.39 Rot.)
S. Gen. No. 2,39) Subject etc.

agf.
3.1.40

delete from S.R.L. Other repairs.

The Certificate of Classification to be endorsed "Cargo battens not fitted" and the same notation to be printed in the Register Book.



© 2020

Lloyd's Register
Foundation

W3-0121 (2/2)