

COPY.

Lloyd's Register of Shipping,

71, Fenchurch Street, E.C. 3.

8th June, 1933.

Dear Sir,

S.S. "CLAN MACNAB"

E. I have to acquaint you that the Owners' Superintendents have called at this Office to-day in regard to the cracked coupling piece at the cone of the thrust shaft, and in this connexion I cabled to you this afternoon, as follows:-

"CLAN MACNAB IF DEFECT IS IN SHORT COUPLING PIECE OVER
"CONE OF THRUST SHAFT CONSIDER IT BEST TO ADOPT OWNERS
"PROPOSAL NAMELY SHRINK STEEL BANDS ABOUT FOUR INCHES
"THICK OVER EACH FLANGE AND FIT HEAVY BOLTED CLAMP
"MIDWAY BETWEEN FLANGES STOP POSSIBLY DERRICK BANDS
"ON BOARD SUITABLE FOR THE CLAMP STOP WELDING NOT
"PERMISSIBLE ON COUPLING PIECE WHICH IS PART OF SHAFT
"LINE STOP USE ALL DESPATCH AND CABLE THIS OFFICE
"IMMEDIATELY THAT WORK IS PROGRESSING"

I am, Dear Sir,

Yours faithfully,

Secretary.

L. Buiskool Esq.,

BATAVIA.



© 2019

Lloyd's Register
Foundation

W377 0211