

offered his services for this purpose, and why they were declined

a damage report made by anyone else? If so, by whom?

PRINTED FOR OIL FIELD

COPY.

Received 8. 6. 33

Captain

CLAN MACNAB

Care Pitcairn, Batavia.

Telegram received effect repair by shrinking band four inches thick on after coupling stop shrink similar band on forward coupling if position of oil baffle allows stop at taper part between flanges fit in halves band full possible length four inches thick with hole tapered to suit taper of body stop fit distance pieces between coupling bolt heads to side of band to prevent possibility of moving telegraph price and time for repair also time and price for renewal of whole coupling consult Surveyor Cayzer



© 2019

Lloyd's Register Foundation

W377-0216

Special Damage or Repair Fee (if any).....

200

19