





On hull deck. - about five strokes of planing on deck port side renewed  
 & about 4 strokes on St. side renewed & remainder of decks calked  
 & tested tight. all mushroom ventilators rejointed. after rail  
 port side faired & refastened. The port life boat was reconditioned  
 refurnished together with falls, gripes etc.

Chief Engineers room - The forward bulkhead released & riveted its attending stiffeners & bounding angles. The room was refurnished as original & as per damage report.

The galley casing on Port side & door was faired & door made to fit the deck. furnishings as per damage report were supplied.

## ANCHORS.

[illegible]

## CHAIN CABLES.

[illegible]