

# REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 19... When handed in at Local Office 8 - AUG 1921 19... Port of NEWCASTLE-ON-TYNE

No. in Reg. Book. Survey held at Jarrow. Date, First Survey 15 July 8 Last Survey 5 August 1921  
21248 on the Wood, Iron or Steel SS KORANTON Master

TONNAGE:- Built at Sunderland By whom W. Boxford & Son Ltd. When 1920 4  
GROSS 6695 Owners R. Chapman & Son Port belonging to Newcastle

UNDER DEK. 6448 Owners' Address  
NET 4122 (if not already recorded in Appendix to Register Book).

Surveyed Afloat or in Dry Dock? Dry Name of Dock Mercantile Destined Voyage  
WB=CellDBorDBa feet; uE&B feet; f feet; f feet; }  
total capacity tons. FPT tons; APT tons; MT feet tons. } Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

N.B.—All alterations in the existing records should be underlined.  
If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

Last Report, No. 6878 Port Syd  
CHARACTER. For Special Survey. Date of last Survey and of Periodical Surveys. Year assigned and now expired. Machinery and Boiler Surveys (including date of N.B., if any).

Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined? Yes - not required Was a damage report made by anyone else? If so, by whom? Underwritten

REPAIRS, OR EXAMINATION AS PER RULE, FOR Docking & Damage.

Vessel placed in dry dock, bottom & rudder examined, cleaned & coated. Breathing decks, casings, coamings hatchways & hatches examined. Damage. The lower portion of cast steel stem frame was found fractured on heel under propeller post. In addition to the fracture on each side there was an irregular fissure on port side close to the fracture but not extending to either edge. Drilling was done on each side in way of the defects and as the fissures were found showing after drilling 2" in from the face, it was recommended that lower part be renewed. This has been done with a forging. Plates (5" in number) removed for access have been replaced.

SUMMARY OF DAMAGE REPAIRS:—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:
Renewed ... ..								Lower part of stem frame
Removed and Fair'd or Repaired ... ..								
Fair'd or Repaired in place ... ..	2							
PRESENT CONDITION OF THE	Stringers	port & good						
Decks	Inner Bottom Plating	not in						
Caulking of Decks	State if Tanks have been examined inside	A.P.						
Waterways	State if Tanks now tested							
Coamings	Bulkheads	port & good						
Beams & Fastenings	Ceiling	not in						
Outside Plating	Cement or Asphalt (State which.)	not in						
Caulking of ditto	Rudder	good						
Rivets	Steering gear and its connections	"						
Breasthooks & Crutches	Windlass	"						
Transoms	Have Pumps now been examined and found efficient?	no						
Frames	Have Sluice Valves now been examined and found efficient?	no						
Reverse Frames	Have Watertight Doors now been examined and found efficient?	no						
Floors								
Keelsons								
	Dblg. Plates under Sounding Pipes	not in						
	Engine Room Skylights	good						
	Coal Bunkers, Open'gs, Lids, &c.	"						
	Scuppers	"						
	Cargo Hatchways	"						
	Hatches	"						
	Planking of Wood Vessels							
	Caulking	ditto						
	Treenails	ditto						
	Breasthooks & Stemson	ditto						
	Transoms, Pointers, & Crutches	ditto						
	Timbers of Frame at openings	ditto						
	Ditto ditto at other places	ditto						
	Stringers, Clamps & Shells	ditto						
	Salting	ditto						
	(State if examined.)							
	Copper, or Y.M. of Wood Vessels							
	(State if on Felt.)							
	When put on, Month	Year						
	Boats	good						
	Masts, Yards, &c.	good						
	Condition, how ascertained							
	(State if wedges removed)	found						
	Sails							
	Equipment letter							
	Anchors, No. of	3B. 15. 1K						
	Cables (State if now ranged)	no						
	length	size						
	(on board)	size						
	Rule length	size						
	Hawser & Warps	good						
	Standing & Running Rigging							

## General Observations, Opinion as to Class, Recommendation, &c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,15," or "to remain as classed and to have record of survey, 1,15, and the notations of ss No. 1-15 and pTND15, &c."

This vessel is now in our opinion eligible to remain as classed subject to "extra" plates (electrically welded) being specially examined next docking.

Survey Fee (per Section 28) £ 2

Special Damage or Repair Fee (if any) (per Sec. 29) £ 15 15 0

Travelling Expenses (if chargeable) £ 2

Second Surveyor's Fee (if any) £ 2

Committee's Minute

Character Assigned 100 A1

Shelter dk with fbd } subject

Fees applied for, 10/8/21

Received by me, 12/21/21

Surveyor to Lloyd's Register of Shipping, Gilbert Gray

TUE. 21 NOV. 1922

TUE. 23 OCT. 1923

TUE. 25 SEP. 1923

Lloyd's Register Foundation

WS2-0129

Is Certificate required? If so, to be sent to



The fractures have been again repaired by electric welding with increased fillet. This repair should again be examined next docking.

THE SURVIVORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

## ANCHORS.

[illegible]

\* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

## CHAIN CABLES.

[illegible]