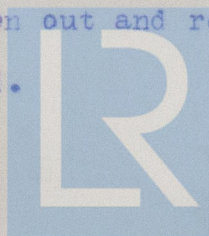


S.S. "BERENGARIA".

NWC. REPT. No. 75474

The electrical installation of above named vessel has been examined and found satisfactory. The following repairs, alterations and additions were carried out whilst lying at the Naval Yard, Walker.

All main cables are lead covered braided with steel tape over the braiding and braided overall. All new cables run in were lead covered and armoured. New main cables to boiler room distribution boxes and all lights in boiler rooms rewired. Fire alarm cable from bridge to aft tunnel renewed. Engine room alarm bell wired permanently. Engine room telegraphs rewired from bridge to engine room. Gyro compass cable rewired from bridge to gyro room. Watertight door cable renewed from bridge to engine room. Stokehold telegraphs rewired, and new position of indicators fixed on ship. Stokehold telephones overhauled. Selector switches in boiler rooms cut out so that boiler room phones can only ring up engine room. Gyro motor generator fitted with new commutator. No. 27 station. Power main renewed to main switchboard. Stores lift. Controller and bottom limit switch repaired. Main engine manoeuvring panel rewired. No. 77 motor - new door fitted on motor. Electric water testing apparatus put in good working order. Flood lights on "A" deck rewired - new fittings fitted. Lights inside foremast about 6 ft. from deck fitted. Light to be thrown upwards. Electric fittings in public rooms removed and replaced. Cable on "A" deck port & starboard side - new cable runs made and new cables fitted. Fog gong motor rewound. 5 electric dumb waiters overhauled. 2nd class cabin annunciators taken out and replaced by bell board. Bearing for No. 33 motor overhauled.

© 2020
Lloyd's Register
Foundation

W572 0040 (1/2)

-2-

New indicator wire in 2nd cabin lift fitted.
Electric oven in 1st class kitchen repaired.
No.2 baggage room lights rewired. Positions altered as required.
No.2 baggage room lift overhauled.
Lights in base of foremast rewired.
Wiring in Ritz Carlton private dining room on B. deck disconnected.
Marconi room telephone from phone in marconi room to J.B. on port side rewired.
Gymnasium A deck. Four way switch, fuse panel and wire from panel to three motor positions fitted.
Lighting fittings in 1st Dining saloon overhauled.
Lights (six) in Verandah cafe wired and fitted.
No.72 exhaust fan armature. Commutator segments loose.
This was repaired and armature tested.
Standard compass wired for one light.

W.T. Badger.

Surveyor to Lloyd's Register.



© 2020

Lloyd's Register
Foundation

W572-0046(2/2) TUE J

TUE JAN. 9 1923