

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report *Jan 4 1932* When landed in at Local Office *Jan 4 1932* Port of *Falmouth*No. in Survey held at *Falmouth* Date, First Survey *9th Dec* Last Survey *Jan 4th 1932*Reg. Book. *26204* on the *Wood, Iron or Steel* *SS "LA CRESCENTA"*TONNAGE *5880* Built at *Haverston Works* By whom *Furness S & Co Ltd* When *1928* YEAR MONTH *6*GROSS *5880* Owners *Crescent Nav. Co Ltd* Owners' Address *(if not already recorded in Appendix to Register Book)*UNDER DEK. *5631* Managers *Harris & Dixon Ltd* Port belonging to *London*NET *3531* Surveyed Afloat or in Dry Dock? *DDK* Name of Dock *Fal No 2 DDK* Destined Voyage *Said up*WB=CellDBorDBa feet; uE&B feet; f feet } Particulars of Classification (which must be inserted
total capacity tons. FPT tons; APT tons; MT feet tons. } precisely as in Register Book & Supplements).X.B.—All alterations in the existing records should be underlined.
If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.Last Report, No. *98508* Port *Lw*

Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarized in the form shown below. Whenever the replacement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Society's Freeboard (if assigned) as painted on Ship and now verified } *8' 1"**not required.*

Was a damage report made by anyone else? If so, by whom?

REPAIRS, OR EXAMINATION AS PER RULE, FOR *Damage as per Barry Report 21420 and**Completion of SS No 2.**Damage:- Vessel in drydock. after cofferdam cleaned & examined internally. Top rivets in P+S sides of crossbunker removed; 14 shell lugs removed & rivetted 2 shell lugs renewed. Internal rivets & renewed or caulked as necessary. Caulking repairs effected on forward bulkhead of cofferdam. & Crossbunker & cofferdam tested after repairs**Completion of SS No 2. Bottom & rudder cleaned examined & renovated. Rudder removed to Shop, braces bored & new pintles fitted. Summer tanks, Cross bunker, & Boiler room double bottom tank examined*

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors	Beams	Str. Plates	Dk. Plates	Other Items
Renewed								
Removed and Fair'd or Repaired								
Fair'd or Repaired in place								

See report.

PRESENT CONDITION OF THE

Decks <i>good</i>	State if Tanks have been examined inside <i>yes</i>	Dblg. Plates under Sounding Pipes <i>yes</i>	Copper, or Y.M. of Wood Vessels <i>✓</i>
Caulking of Decks <i>"</i>	State if Tanks now tested <i>"</i>	Engine Room Skylights <i>good</i>	(State if on Feet) When put on, Month <i>✓</i> Year <i>✓</i>
Coamings <i>"</i>	Bulkheads <i>good</i>	Coal Bunkers, Open'gs, Lids, &c. <i>"</i>	Boats <i>good</i>
Beams & Fastenings <i>✓</i>	Ceiling <i>✓</i>	Scuppers <i>"</i>	Masts, Yards, &c. <i>"</i>
Outside Plating <i>good</i>	Cement or Asphalt (State which) <i>✓</i>	Cargo Hatchways <i>✓</i>	Condition, how ascertained <i>off</i>
Breasthooks <i>good</i>	Rudder <i>good</i>	Hatches <i>✓</i>	(State if wedges removed) <i>✓</i>
Transoms <i>good</i>	Steering gear and its connections <i>"</i>	Planking of Wood Vessels <i>✓</i>	Sails <i>✓</i>
Frames <i>good where exam'd</i>	Windlass <i>"</i>	Caulking ditto <i>✓</i>	Equipment letter <i>2</i>
Reverse Frames <i>"</i>	Have Pumps now been examined and found efficient? <i>yes</i>	Treenails ditto <i>✓</i>	Anchors, No. of <i>3A-13</i>
Longitudinals <i>"</i>	Have Sluice Valves now been examined and found efficient? <i>yes</i>	Breasthooks & Stemson ditto <i>✓</i>	Cables (State if now ranged) <i>part.</i>
Transverses <i>"</i>	Have Watertight Doors now been examined and found efficient? <i>✓</i>	Transoms, Pointers, & Cratches ditto <i>✓</i>	Rule length <i>✓</i>
Floors <i>"</i>	Have Ventilators and their Coamings been examined and found efficient? <i>yes</i>	Timbers of Frame at openings ditto <i>✓</i>	Hawser & Warps <i>sufficient</i>
Keelsons <i>"</i>		Ditto ditto at other places ditto <i>✓</i>	Standing and Running Rigging <i>good</i>
Stringers <i>"</i>		Stringers, Clamps & Shells ditto <i>✓</i>	
Inner Bottom Plating <i>"</i>		Saltlog ditto <i>✓</i>	

General Observations, Opinion as to Class, Recommendation, &c.;

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey 1,24," or "to remain as classed and to have record of survey, 1,24, and the notations of ss No. 1-24 and ptND24, &c."

*This vessel is eligible in my opinion to remain as classed with fresh record of Survey 1.32. & to have the notation**SS Bry No 2. 30 as previously recommended. subject to electric welding repairs to Stem F.1 Port & Stern E. Port being examined next docking*

Survey Fee (per Section 29) £

Fees applied for,

Special Damage or Repair Fee (if any) (per Sec. 29) £

Received by me,

Travelling Expenses (if chargeable) £

19

Second Surveyor's Fee (if any) £

Committee's Minute

Character Assigned

Surveyor to Lloyd's Register of Shipping.

© 2019

Lloyd's Register Foundation

Rechnung

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

ANCHORS.

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower

CHAIN CABLES.

© 2019

W604-0059