

LLOYD'S REGISTER OF SHIPPING

Newport News, Va.,

January 9th, 1923.

THIS IS TO CERTIFY that

O. J. HUDSON.

The undersigned Surveyor to this Society did at the request of the London Salvage Association, of 68 Broad Street, New York, attend aboard the Steel Screw Tank Steamer "SWIFTSTAR" of New York, 8270 gross as she lay in the dry dock at the Works of the Newport S. & D. D. Co., Newport News, Va., on January 3rd, 1923 and subsequent dates for the purpose of ascertaining the nature and extent of the damage stated to have been caused by tugs during Salvage operations whilst the vessel was aground off Block Island, on October 10th, 1922.

With regard to the oil and dirt on vessels side these indents were not observable until same had been cleaned, when it was found that:-

Port Side:-

Shell plates Nos. 18 & 19 in "J" strake and shell plates Nos. 18 & 19 in "K" strake were set in.

Shell plate No. 17 in "J" strake slightly set in.

Shell plates Nos. 17 & 20 in "K" strake slightly set in.

RECOMMENDED:-

These plates be removed, faired and refitted.

This plate be faired in place.

These plates be faired in place.



© 2021

Lloyd's Register  
Foundation

4672-0063



S/S "SWIFTSTAR"

January 9th, 1923.

FOUND:-

RECOMMENDED:-

Side:-

longitudinal frame in way  
J" 18 & 19 set in.

This longitudinal frame be  
removed, faired and refitted.

main deck stringer plate and  
stringer angle in way of plates  
J" & "K" strakes buckled and

This main deck stringer plate  
and stringer angle be partly  
cut adrift, faired and re-riveted.  
It was also recommended that  
the tanks in way of these  
repairs be tested and proved  
tight and that the repaired  
work be recoated as before.

24" Ventilator Cows on  
ter deck reported lost.

Two new ventilator cows be  
made and fitted on board.

vertical worm shaft of main  
turning gear bent.

This vertical worm shaft be  
removed, straightened and  
refitted and the worm on same  
be trued up and replaced.

Port Cargo Pump

pump rod fractured and the  
rod in crosshead on other  
rod of pump partly stripped.

A new pump rod be made and  
fitted to crosshead and bucket  
and that the thread of the  
other pump rod be trued up and  
a new crosshead be made and  
fitted.

foregoing work was done as per signed work list mailed you on  
January 3rd, 1923, for the sum of \$2,625.00.

\$25.00

(signed) C. J. HUDSON  
Surveyor.

© 2021

Lloyd's Register  
Foundation  
W 877-0063