

UNCLASSIFIED

LLOYD'S REGISTER  
LONDON.

ADVISED TO  
Falmouth

REC'D 20 MAY 1921

ANS <sup>ack 4/6/</sup>  
Port of COLOMBO,

6th March 1921.

SURVEY REPORT - S.S. "JAVARY".

THIS IS TO CERTIFY THAT I, the undersigned, did  
at the request of the Commander of the s.s. "JAVARY", Official No.  
143356, and with the sanction of the Local Agents, proceed on  
board the above vessel to examine port main boiler reported  
defective.

ON EXAMINATION I FOUND the saddle and wrapper  
plate seams in all combustion chambers leaking, also several leaky  
rivets on same. The combustion chamber stays are leaking, also  
several smoke tubes, three of which are cracked at mouth.

R E C O M M E N D A T I O N S.

I RECOMMEND THAT defective rivets on saddle and  
wrapper plate be cut out, plates to be drawn up and ~~xxx~~ reriveted  
and caulked, nuts on leaky stays to be taken off, stays caulked,  
new washers to be fitted & nuts refaced, split tubes to be cut out  
and new tubes fitted, and leaky tubes re-expanded.

*Abbauphill*

Actg. Lloyd's Surveyor.



© 2021

Lloyd's Register  
Foundation