

S. S. PRINCESS-

The refrigerating machinery was not submitted for examination.

Repairs - 1st intermediate bottom end bushes re-metalled. (Port engine)

H. P. bottom end bushes of starboard engine re-metalled.

All furnaces cut out of main and auxiliary boilers.

All plain and stay tubes cut out, tube plates (back) of all the boilers removed, new furnaces fitted, tube plates re-fitted and rivetted and all plain and stay tubes renewed. A few C.C. screwed stays removed for access have been refitted.

Main and auxiliary boilers tested by hydraulic pressure to 305 lbs. on completion of the above repairs, and found tight.

Thomas W. C. Napier

N.B.-If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THE MARGIN.



© 2020

Lloyd's Register
Foundation