

-2 COPY.

## Lloyd's Register of Shipping.



forward bulkhead plate slightly bulwark plate & roll bar to be  
rail bar bent.

removed fairied & refitted.  
of A M T W R P.

& supports slightly bent. To be fairied in place.

Port

stringer plate bent. 2nd January 1929. fairied & repointed.

met up.

930.

lower set of poop deck.

center counter plate set in. To be removed fairied & refitted.

colliding bar in my boat.

This is to Certify that

forward stringer plate ADORNED C. 1/4" to be removed.

the undersigned Surveyor to this Society did at the request of the Owners survey the S/S "PATAGNIER" 5172 tons gross of Antwerp for the purpose of ascertaining the nature & extent of the damage stated to have been sustained:-

1) through collision with the quay wall at Antwerp on the 4th February 1928. bent. To be removed fairied & refitted.

2) through collision with the S/S "CAUCASIER" at Antwerp on the 21st March 1928. To be removed fairied & refitted.

3) through collision with the quay wall at Antwerp on the 23rd of December 1928. To be removed fairied & refitted.

4) through hatch beam being dropped on tank top in hold No.1 at Hobito on the 1st of September 1929.

5) through fire in the cross bunker from 5th to 9th October 1929 during a voyage from Bahia Blanca to Las Palmas.

To be removed fairied & refitted.

For further particulars please see log book.

On the 2nd of December 1929 and at subsequent dates the vessel then lying in dry dock at Antwerp, the undersigned upon making examination found damage & recommended repairs as follows:-

FOUND

RECOMMENDED

1st Damage.

One deck pipe, 1 hatch cover frame.

On the bridge deck starboard side.

© 2020

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

While the Committee use their best endeavours to ensure that the functions of the Society are properly executed, it is understood that neither the Committee nor the Society are under any circumstances whatever to be held responsible for accuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other document of the Society, or for any error of judgment, default, or negligence of the Surveyors, or other Officers or Agents of the Society."

HIER"

-2-

## FOUND

## RECOMMENDED

termost bulwark plate slightly bent in a rail bar bent. Bulwark plate & rail bar to be removed faired & refitted.  
port skid supports slightly bent. To be faired in place.  
port skids stringer plate & bar lightly set up. To be released faired & replaced.

1 Damage.

starboard counter plate slightly

at starboard end of poop deck.

centre counter plate set in. To be removed faired &amp; refitted.

buliding bar in way bent. To be removed faired &amp; refitted.

termost stringer plate of poop deck buckled. To be renewed.

stringer bar in way bent. To be croppped &amp; partly renewed.

centre line cantilever frame, bows &amp; knee slightly bent. Frame &amp; beam to be faired in place knee to be removed faired &amp; refitted.

facilitate the above repairs tealights bracket bent. To be removed faired &amp; refitted.

right removed, and the whole in a manner so to place the vessel in condition as she was before &amp; fittings to be removed for access &amp; refitted.

2 Damage.

port side of forewell.

egsl &amp; 2 bulwark plates set in.

ail bar in way bent.

stanchion bent.

To be removed faired &amp; refitted.

To be removed faired &amp; refitted.

To be removed faired &amp; refitted.

6 stanchions &amp; their shell lugs to be removed for access.

Deck lugs to be faired in place.

One deck pipe, 1 wash port frame,

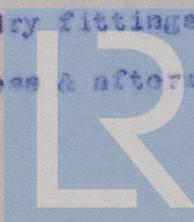
one scoring pipe &amp; doubling, &amp;

muniiry fittings to be removed for access &amp; aftersavis refitted.

3 Damage. Hold No. 1

W71-0238 (2/3)

ARTIFICATE NO. 10.2.30

Lloyd's Register  
Foundation

FRI. 11 JUL 1930

Key Boilers  
ure

Managers

Port Antwerp Voyage C

On (wh.  
Book dYears  
assigned  
now  
expired

PATAGONIER

-3-

## RECOMMENDED

FOUND  
plate No. 2 of stoke A of tank top Plate to be renewed.

on port side fractured. Tank to be tested after repairs.

5th Damage.Cross bunker.

Plate No. 1 of stoke E of lower deck standard side slightly buckled.

3 pillars in tween deck to be removed for access & afterwards refitted.

In lower bunker, lower plate of forward bulkhead renewed & faired in  
undersigned Surveyor to this place, at the request of  
bulkhead slightly set in.

ALSO RECOMMENDED that all fittings removed to effect a facilitate the above repairs be replaced as before all new & repaired work be coated inside & outside as before, all broken cement renewed, and the whole of the repairs carried out in such a manner as to place the vessel in the same good & efficient condition as she was in before the alleged damages were sustained.

FEE & TAX. PR. 1800.-Signature: *H. Letay*  
SURVEYOR TO LLOYD'S REGISTER

ANTWERP.

Also recommended that all glassing removed to facilitate the renewing process be replaced as before, all new repairs being put in such a manner as to place the hull in the same good & efficient condition as she was in before the alleged damages were sustained.



© 2020

Lloyd's Register  
Foundation

W71-0232(3/3)

Lloyd's

FRI. 11

FRI. 11

Signed + Dated 12.29

CERTIFICATE 10.2.30

FRI. 11 JUL 1930