

Mr. J. W. Miller
LONDON

SAN FRANCISCO,

May 17th 1917.

THIS IS TO CERTIFY that

ARNOLD BENNETT,

the undersigned Surveyor to this Society did at the request of the Union Iron Works Company, Builders of the Steel Screw Steamer "WAR KNIGHT", Yard No.133, and also of P.A.Beacon, Esqr., Lloyd's Agent, San Francisco, survey the said vessel in order to ascertain the nature and extent of damage stated to have been sustained on April 7th 1917 through striking bottom while the vessel was being towed in light condition from Alameda to San Francisco for completion after being launched.

On May 12th 1917 and on subsequent dates while the vessel was on floating dock at Potrero Works of the Union Iron Works, San Francisco, the undersigned upon examination

FOUND:

- 1-shell plate, No.18 in
E strake, starb.side,
indented.
2-shell plates, Nos.13 & 14
in E strake, starb.side,
slightly set up.

20-feet Bilge Keel plate
buckled.

Adjoining ends of Bilge Keel
plate slightly bent for
about 6 feet.

RECOMMENDED:

To be removed, faired
and replaced.

To be released, and
faired in place.

To be removed, faired
and replaced.

Plates to be released
and faired in place.

-1-

1/20 1/2
-0120-0120



© 2020

Lloyd's Register
Foundation

On completion of repairs No.2 Ballast Tank to be
busted under pressure and all work to shell plating above
tank margin to be hose tested and proven tight.

All brackets, clips, wood ceiling, cargo battens
removed in course of these repairs, to be afterwards
replaced in good condition as before the casualty.

Bituminous cement disturbed in way of repairs to
be replaced.

All new and repaired work to be repainted.


The foregoing repairs have been completed to the
satisfaction of the undersigned.

(Signed) ARNOLD BURRITT.

Surveyor to Lloyd's Register.

50 -

WTU-0120 $\frac{2}{2}$

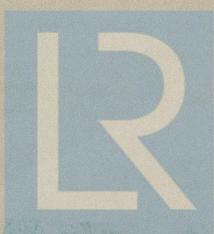

© 2020

Lloyd's Register
Foundation