

Rpt. S.

46 Toh

(Received at London Office

SAT. 13 AUG. 1921

WRECK

No. 46 Toh

No. 887

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 19th July 21 When handed in at Local Office 19th July 21 Port of Vancouver B.C.No. in Survey held at Victoria B.C. Date, First Survey 13th July Last Survey 16th July 1921

Reg. Book. 11285 on the Wood, Iron or Steel S.S. "CANADIAN EXPORTER" Master W. Braden

TONNAGE:-

GROSS 5498

UNDER DK. 4899

NET 33845

Built at Vancouver

Owners Canadian Government

Owners' Address As recorded

(if not already recorded in Appendix to Register Book)

By whom J. Coughlan & Sons

YEAR 1920

MONTH 3

When 1920 3

Port belonging to Montreal

Surveyed Afloat or in Dry Dock? Both

Name of Dock Government Dock

Destined Voyage Australia & New Zealand

WB=Cell DBor DBa

feet; uE&B

feet; APT

feet; MT

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)

N.B.—All alterations in the existing records should be underlined.
If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, and of the inner bottom plating, especially in the boiler space.

st Report, No. 846 Port VCR

Special Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the nature of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs due to account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the placement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

CHARACTER
X for Special Survey
Date of last Survey and of Periodical Surveys

Damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined? *report attached* Was a damage report made by anyone else? If so, by whom?

PAIRS, OR EXAMINATION AS PER RULE, FOR *Damage & Condition*.— *Damage stated to have been sustained through the vessel striking the Dominion Government wharf in the Harbour at Vancouver on 30th July 1920. For further particulars see Log Book.*

An examination in the Vessel going in dry dock found:—
Shell plate G N 4 Port side buckled in way of bulkhead at after end of N^o 1 Hold, also the frame on forward side & the frame on after side of the bulkhead slightly set in and a number of rivets & some caulking started at bulkhead bounding angle and at shell plating in way of G N 4.

Now DONE for Damage:— *Shell plate G N 4 also on frame on each side of bulkhead failed in place, the shell and bulkhead riveting failed a few rivets being cut out and renewed & the started caulking made good.*

SUMMARY OF DAMAGE REPAIRS:—

	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:—
Renewed	✓							
Removed and Paired or Repaired	✓	2						
Faired or Repaired in place	✓							

PRESENT CONDITION OF THE

Decks	good	Stringers	good	Dblg. Plates under Sounding Pipes	✓	Copper, or Y.M. of Wood Vessels	✓
Caulking of Decks	✓	Inner Bottom Plating	good	Engine Room Skylights	good	(State if on Felt.)	✓
Waterways	✓	State if Tanks have been examined inside	AP only	Coal Bunkers, Open'gs, Lids, &c.	✓	When put on, Month	Year
Hamings	✓	State if Tanks now tested	AP only	Scuppers	✓	Boats	good
Beams & Fastenings	✓	Bulkheads	good	Cargo Hatchways	✓	Masts, Yards, &c.	✓
Outside Plating	✓	Ceiling	✓	Hatches	✓	Condition, how ascertained	from deck
Caulking of ditto	✓	Cement or Asphalt	✓	Planking of Wood Vessels	✓	(State if wedges removed)	✓
Rivets	✓	(State which.)	good	Caulking	ditto	Sails	2
Breasthooks & Crutches	✓	Rudder	✓	Treenails	ditto	Equipment letter	2
Transoms	✓	Steering gear and its connections	✓	Breasthooks & Stenson	ditto	Anchors, No. of	5
Frames	✓	Have Pumps now been examined and found efficient?	✓	Transoms, Pointers, & Crutches ditto	✓	Cables (State if now ranged)	no
Reverse Frames	✓	Have Sluice Valves now been examined and found efficient?	✓	Timbers of Frame at openings ditto	✓	„ length	100 ft
Floors	✓	Have Watertight Doors now been examined and found efficient?	✓	Ditto ditto at other places ditto	✓	„ Rule length	100 ft
Keelsons	✓			Stringers, Clamps & Shells ditto	✓	Hawser & Warps	good
				Salting (State if examined.)	ditto	Standing & Running Rigging	✓

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—“to remain as now classed in the Register Book without fresh record of Survey,” “to remain as classed and to have record of survey, 1,15,” or “to remain as classed and to have record of survey, 1,15, and the notations of ss No. 1-15 and ptND15, &c.”

This Vessel is now in efficient condition eligible in my opinion to remain as classed with fresh record of survey, subject to additional wash plate fitted in after peak tank, or, the after Peak bulkhead fitted with additional stiffeners on return of Vessel from Australia

Survey Fee (per Section 28) £

Fees applied for,

Special Damage or Repair Fee (if any) (per Sec. 28)

\$ 35.00

Received by me,

Travelling Expenses (if chargeable)

\$ 12.75

19

Second Surveyor's Fee (if any) £

Committee's Minute

Character Assigned

TUE. 23 AUG. 1921

100A1 subject

TUE. SEP. 27 1921

Surveyor to Lloyd's Register of Shipping.

W734-0067

Lloyd's Register Foundation

Is Certificate required? If so, to be sent to

A few rivets leaking through shell plate D N^o 2 (from after end of Vessel) on Port side in way of W. T. flat & after Peak tank also a few rivets started through shaft tunnel near top in way of the connecting lug & bulkhead stiffener bracket.

Now done:— Four welds cut out through shell plate D.N. 2 and one through turret rear top & removed, the riveting & caulking in way of parts found leaking tested & made good and on completion of repairs the after Peak tank tested with water pressure and found satisfactory.

Recommended that ^{an} additional wash plate be fitted in the after peak tank or that the bulkhead be strengthened by fitting additional stiffeners & brackets. The Owners representative states the above recommendation will be submitted to the Owners with view to this work being carried out on return of the vessel to the port from Australia and that until such time as the recommendation is carried out the after peak tank will not be used as a "fuel" tank but for ballast purposes only being either full of water or empty.

Bottom & reader checked examined found in good condition & re-coated.

When Anchors or Cables are supplied, the particulars are to be reported in the following form:—

ANCHORS.

[illegible]

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

CHAIN CABLES.

[illegible]