

Damage due to grounding
Screw shaft, propeller, sea connections
crank & thrust shaft, condensers, &
pumps examined & minor repairs

Effectuated.

P.S. due 3.16 now held.

It is submitted that
this vessel is eligible for
THE RECORD BSG.16

SG.16. subject to the DB
not being used.

J.W.D.
12/7/16

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THE MARGIN.



© 2021

Lloyd's Register
Foundation

It is taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

Damage and Boiler Survey

S/S "Tarpeia"

Propeller shaft renewed.

Crank & Thrust Shafts Condenser & Pumps examined
LP Guide overhauled. LP Valve gear overhauled. Two
Column head (aft) bolts fractured renewed. Holding
down bolts overhauled. Condenser tested. Reversing
gear overhauled. All pump rams & rods trued
up & relubricated. Thrust Shoes dressed up.

Main Boiler examined externally and
internally & found in fair condition

Safety valves & mountings examined & overhauled.

Several Screw Stag nuts renewed. Collision Chock
at fore end renewed. Internal pipes in Main & Smoke

Chock valves & chests renewed.

Boiler examined under steam and Safety
valves adjusted & blow at working pressure.

N.B. - If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THE MARGIN.



© 2021

Lloyd's Register
Foundation