

COPY.

Lloyd's Register of Shipping.



Port

ALEXANDRIA,

16th July, 1940.

This is to Certify that

I, HENRY BISHOP,

the undersigned Surveyor to this Society did at the request of Messrs. PHARAONIC MAIL LINES S.A.E., Alexandria, and Captain YOUIL Master of the Steel Screw Cable Vessel "RETRIEVER" 674 tons gross of London, attend on board that vessel whilst she was lying anchored in the outer harbour of this Port in order to survey vessel afloat, the Master reporting the vessel to have touched the bottom whilst carrying out cable service operations near Agami, outside the Port of Alexandria about 9.35 A.M. on the 15th July 1940. There was a slight swell and breeze at the time of touching the ground causing vessel to rise and pound, vessel shortly afterwards refloated with own power and proceeded into this Port, whilst proceeding slight leakage was found on sounding No. 1 double bottom tank carrying fresh water.

Admiralty divers attended the vessel the same day at 7.0 P.M. and reported that no damage had occurred as far as could be ascertained but definite signs were noted that the vessel had touched bottom at the forward end of Port bilge keel.

On taking soundings at seven P.M. the leakage had increased to three inches and no alterations of soundings in other tanks.

After examination of all particulars the vessel was examined and soundings taken and it was evident that leakage existed in the No. 1 double bottom tank but was of a minor nature and under control of

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

ship's pumps and in the opinion of the undersigned leakage was due to strained bottom shell rivets resulting on the said accident.

As the N°1 double bottom tank top doors were not accessible and the leakage under control, also the vessel urgently required to complete her service operation, I am of opinion that action for repairs in Drydock may be deferred until the first convenient opportunity, when it is recommended that vessel be drydocked for further survey and permanent repairs effected to the damage sustained.

Surveyor's Fee and this Report:- £.4. 4. 0.

Expenses:- 5. 0.

£.4. 9. 0.

ALEXANDRIA (EGYPT) 15th JULY, 1940.

H. Bishop
SURVEYOR
LLOYD'S REGISTER



© 2020

Lloyd's Register
Foundation

W76-0105(212)