

S/S. "Floer"

3 upper deck plates removed. faired & refitted, & 2 faired in place.

4 " " beams removed. faired & refitted & 2 faired in place.

3 frames part renewed & 2 faired in place.

1 Intercostal side stringer plate renewed, together with face angle

Main deck:- 1 stringer plate & angle renewed. 1 stringer plate faired in place. 1 deck plate removed. faired & refitted. 1 faired in place.

1 Beam faired in place

Dunn top ceiling rose held. Lifted also lumber & margin, & spar ceiling

Dunn top plating, bilges & ship's side scaled & recoated, & ceiling margin & lumber replaced with fast new material. Necessary fittings in way of above repairs removed. repaired & refitted.

Heavy weather:-

Hand steering gear found more rollers broken. started & damaged now removed ashore, overhauled with necessary new parts & refitted. Steering chains annealed & repaired.

General repairs.

Bunkers plating & stiffeners part renewed. Hold & Tween deck stanchions repaired & refitted. New pin fitted to 3rd Anchor quality of material satisfactory. Caps for sounding pipes part renewed. New windows fitted.

C. P. Harris.

W. Burn.



© 2020

Lloyd's Register
Foundation

W893-0089 3/2