

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report *5th Mar 1917* When handed in at Local Office *6th Mar 1917* Port of *New York*
No. in Reg. Book. *892* Survey held at *Brooklyn L.Y.* Date, First Survey *14th Feb* Last Survey *23rd Feb 1917*
Act on the Wood, Iron or Steel *S.S. "CHORLEY"* (No. of Visits *4*) Master *A. Henry*
TONNAGE:— Built at *Stockton* By whom *Richardson Dock Co* When *1901*
GROSS *3828* Owners *Buss & Lyken Ltd* Port belonging to *London*
UNDER DECK *3541* Owners' Address
2468 (if not already recorded in Appendix to Register Book.)

oyed Afloat or in Dry Dock? *Yes* Name of Dock *Robins Dry Dock* Destined Voyage *France*

Cell/Dor/Dba (feet; uE&B feet; f feet; f)
capacity tons. FPT tons; APT tons; MT feet tons.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

B. All alterations in the existing records should be underlined.

If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, and of the inner bottom plating, especially in the boiler space.

t Report, No. *2302* Port *Bdx*

| CHARACTER, * for Special Survey, Date of last Survey and of Periodical Surveys. | Years Assigned now expired | Machinery and Boiler Surveys (including date of N.B., if any). |
|--|-------------------------------------|--|
| <i>+100 A1</i> | | <i>+LMC 10-13</i> |
| <i>Shells 4-16</i> | | <i>MBS 4-16</i> |
| <i>S.S. 5th Mar 1917</i> | | <i>TS 4-16</i> |
| | | <i>BS 10-14</i> |
| | | <i>NDB 13</i> |

ical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs count of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; esides being detailed in the body of the report, should be summarised in the form shown below. Whenever the cement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on ck of this form. State also the dates and initials of any letters respecting this case.

Society's Freeboard (if assigned) as painted on Ship and now verified

age cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why were declined? Was a damage report made by anyone else? If so, by whom?

RS, OR EXAMINATION AS PER RULE, FOR

Damage stated to have been sustained through the vessel grounding at the entrance of the Gironde River 27th December 1916, on a voyage to Bordeaux.

Work done: Bottom & Rudder cleaned & examined and after repairs coated. A few defective shell rivets in peaks removed.

DAMAGE REPAIRS

HEEL STRAKE No 2 & 3 plates removed & fair and replaced

7" STRAKE No 2 & 3 plates part cut adrift and fair in place per Surveyor's Letter 29th Jan 1917. The deck plating has not been dealt with this time & permanent repairs have not been effected to the steering gear. The windlass has been repaired and is now in good order.

| RY OF DAMAGE REPAIRS:— | Plates. | Frames. | R. Frames. | Floors. | Beams. | Str. Plates. | Dk. Plates. | Other Items:— |
|----------------------------------|----------|---------|------------|---------|--------|--------------|-------------|---------------|
| Renewed ... | | | | | | | | |
| Removed and Fair or Repaired ... | <i>2</i> | | | | | | | |
| Fair or Repaired in place ... | <i>2</i> | | | | | | | |

| CONDITION OF THE | Stringers | Inner Bottom Plating | State if Tanks have been examined inside | State if Tanks now tested | Bulkheads | Ceiling | Cement or Asphalt (State which.) | Rudder | Steering gear and its connections | Windlass | Have Pumps now been examined and found efficient? | Have Sluice Valves now been examined and found efficient? | Have Watertight Doors now been examined and found efficient? |
|------------------|-------------|----------------------|--|---------------------------|-----------|---------|----------------------------------|--------|-----------------------------------|----------|---|---|--|
| of Decks | <i>Good</i> | | | | | | | | | | | | |
| Fastenings | <i>Good</i> | | | | | | | | | | | | |
| Plating | <i>Good</i> | | | | | | | | | | | | |
| of ditto | | | | | | | | | | | | | |
| Ke & Crutches | | | | | | | | | | | | | |
| Frames | | | | | | | | | | | | | |

| Dblg. Plates under Sounding Pipes | Engine Room Skylights | Coal Bunkers, Open'gs, Lids, &c. | Scuppers | Cargo Hatchways | Hatches | Planking of Wood Vessels | Caulking | Treenails | Breasthooks & Stemson | Transoms, Pointers, & Crutches ditto | Timbers of Frame openings ditto | Ditto ditto at other places ditto | Stringers, Clamps & Shells | Safting | Copper, or Y.M. of Wood Vessels (State if on Felt.) | When put on, Month | Boats | Masts, Yards, &c. | Condition, how ascertained (State if wedges removed) | Sails | Equipment letter | Anchors, No. of | Cables (State if now ranged) | length (on board) | Rule length | Hawser & Warps | Standing & Running Rigging |
|-----------------------------------|-----------------------|----------------------------------|----------|-----------------|---------|--------------------------|----------|-----------|-----------------------|--------------------------------------|---------------------------------|-----------------------------------|----------------------------|---------|---|--------------------|-------|-------------------|--|-------|------------------|-----------------|------------------------------|-------------------|-------------|----------------|----------------------------|
| <i>Good</i> | | | | | | | | | | | | | | | | | | | | | | | | | | | |

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,15," or "to remain as classed and to have record of survey, 1,15, and the notations of ss No 1-15 and ptND15, &c."

This Vessel is eligible in my opinion to remain as classed with record of survey 2-17, subject to the deck plating and steering engine being repaired at the first favourable opportunity.

cc (per Section 28) £
Damage or Repair Fee (if any) *£10.00*
Expenses (if chargeable) £
Second Surveyor's Fee (if any) £

Fees applied for, *13.3* 10 17
Received by me, *19*

John Robinson


Surveyor to Lloyd's Register of Shipping.

Committee's Minute

New York MAR 15 1917

Character Assigned

*100% Shell Dk, Subject (N.M.)
N.T.S. 2.17*

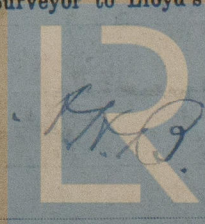

© 2020

Lloyd's Register Foundation

W920-0118/2

THU. 29. MAR.

Port of

Continuation of Report No. 13644 dated 5th March, 1917 on the

working order, a new side frame having been fitted. The Owners Representative stated also time would not permit of repair being carried out to the diesel starting engine at this time but that arrangements would be made to have same carried out on the V. vessel return to the port from France in about three months, as the diesel & starting engines are in my opinion in safe condition the above is submitted for the favourable consideration of the Committee.

PK

ANCHORS.

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

[illegible]