

Port of Sunderland.October 31st 1932

REPORT ON MASTS, SPARS, AND RIGGING.

Dear Sirs

Having, in accordance with your instructions,
examined the Masts, Spars, Iron Work of same, and Rigging, of the

(Name of Vessel) SS King Robert Lying at Greenwells Quay
on the (Date of examination) October 31st 1932,

I have to report that I found Main Topmast decayed at
the Lower mast Head, Port N^o 3 Merrick decayed at
the inner end, recommend the aforesaid to be renewed
Starboard N^o 1 Merrick and Port N^o 2, decayed at shoe
ends. Recommend these to be cut and shoe's refit.
Shoe eye of Port N^o 1 Merrick strained and Bent.
Recommend shoe be removed, repaired and refit.
Further recommend, that Rigging screws, and Shackles
Fore and main masts and Port and Starboard Merrick
Posts, also Merrick Ironwork, be annealed and made good.
Masts, Rigging, other spars and Ironwork in good condition.

A D Pearson

Fee £ : :

To the Surveyors,
Lloyd's Register of Shipping,
Sunderland

2m, 11, 30.



© 2019

Lloyd's Register
Foundation