

REPORT of SURVEY for REPAIRS, &c.

of writing Report 31. 1. 1928 When handed in at Local Office 31. 1. 1928 Port of Barry

Survey held at Barry Date, First Survey 19 1. 28 Last Survey 28 1. 1928

Book. (No. of Visits 5)

3570 on the Wood, Iron or Steel 45. Westbury Master

TONNAGE:— Built at Burntisland By whom Burntisland (B&R) When 1927

GROSS 4800 Owners Alexander Ship & Co Port belonging to London

UNDER DECK 4454 Owners' Address Copper Alexander & Co Managers

NET 2950 (if not already recorded in Appendix to Register Book).

Surveyed Afloat or in Dry Dock? On/Off Name of Dock Spaving Destined Voyage

B=CelldBorDBa feet; uE&B feet; f feet; } Particulars of Classification (which must be inserted

tal capacity tons. FPT tons; APT tons; MT feet tons.} precisely as in Register Book & Supplements).

N.B.—All alterations in the existing records should be underlined.

If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

Last Report, No. Port

Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Society's Freeboard (if assigned) as painted on Ship and now verified ft. ins.

Yes not required Was a damage report made by anyone else? If so, by whom? Salvage Insurance

REPAIRS, OR EXAMINATION AS PER RULE, FOR Damage stated to have been sustained

by striking dock wall on 11 January 1928 at Burntisland.

Vessel placed in dry dock, bottom examined, not recoated.

Port side. E10 & 9.9. removed, fairied & repitted, 2 B.A. frames in way removed, fairied & repitted, one large bracket renewed, & one removed, fairied & repitted. Ceiling over bilges, spar ceiling, & cement in way of repairs removed & replaced. Bridge cushion pipes removed & replaced.

Starboard side!— E 5. F 6. E 11 fairied in place.

SUMMARY OF DAMAGE REPAIRS:—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:—
Renewed								Bridge Brackets &c.
Removed and Fairied or Repaired	2	2						
Fairied or Repaired in place	3							

PRESENT CONDITION OF THE								
Decks	State if Tanks have been examined inside	Dblng. Plates under Sounding Pipes	Copper, or Y.M. of Wood Vessels (State if altered.)					
Plating of Decks	State if Tanks now tested	Engine Room Skylights	When put on, Month Year					
Stairways	Bulkheads	Coal Bunkers, Open'gs, Lids, &c.	Boats					
Stairways	Ceiling	Scuppers	Masts, Yards, &c.					
Stairways	Cement or Asphalt (State which.)	Cargo Hatchways	Condition, how ascertained (State if wedges removed)					
Stairways	Rudder	Hatches	Sails					
Stairways	Steering gear and its connections	Planking of Wood Vessels	Equipment letter					
Stairways	Windlass	Caulking ditto	Anchors, No. of					
Stairways	Have Pumps now been examined and found efficient?	Treenails ditto	Cables (State if now ranged)					
Stairways	Have Sluice Valves now been examined and found efficient?	Breasthooks & Stemson ditto	length (on board) size					
Stairways	Have Watertight Doors now been examined and found efficient?	Transoms, Pointers, & Crutches ditto	Rule length size					
Stairways	Have Ventilators and their Coamings been examined and found efficient?	Timbers of Frame at openings ditto	Hawser & Warps					
Stairways		Ditto ditto at other places ditto	Standing & Running Rigging					
Stairways		Stringers, Clamps & Shells ditto						
Stairways		Salting ditto						
Stairways		(State if examined.)						

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:— "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,15," or "to remain as classed and to have record of survey, 1,15, and the notations of ss No. 1-15 and ptND15, &c."

This report is forwarded for the information of the Committee

Survey Fee (per Section 20) £ 3 : 3 : Fees applied for, 31. 1. 1928

Special Damage or Repair Fee (if any) (per Sec. 20) £ : : Received by me, 12/3/28

Travelling Expenses (if chargeable) £ : : Surveyor to Lloyd's Register of Shipping.

Second Surveyor's Fee (if any) £ : :

Committee's Minute FRI. 10 FEB 1928

Character Assigned see minute on LTH 7. E. Rpt 17316

Lloyd's Register Foundation

W 99-0030