

Whitley 11<sup>th</sup> Memorandum of Repairs  
of the Ship *San Antonio*  
Solomon Chapman Esq.  
by Mr Langborn & May  
12<sup>th</sup> 1835

Ceiling taken of below the  
Hold beams on each side  
from the Mainmast Aft.  
Starboard side, 6 Second Futtocks  
and 8 <sup>Main</sup> Timbers —

Port Side 2 Second Futtocks &  
4 Main Timbers.

N. B. Timber well chocked &  
taken out were required  
ceiling replaced with new 3<sup>rd</sup>  
Plattic Fir.

A thick plank (or Whore) under  
the Holdbeams on each side  
American White Oak 52 feet  
in length, 13<sup>th</sup> 7 inches



Thick at the upper and 6 inches  
on the lower Edge, extending  
from the turn of the Mow,  
to the Quarter on each side  
completely bolted to the ~~rod~~  
beams & string, also thro' the  
sides and clinched. —

Outside Midship keel  
new also sandstrokes on  
each side, several Planks  
in the Flat of the Floor  
shifted (were required)

Six Strakes on each Quarter from the second Futtock  
shifted <sup>outwards</sup> as far Forward <sup>downwards</sup>  
as required. —

Ship completely caulked,  
and examined fastening of the  
bolts —

W. Langbourn