

REPORT OF SURVEY FOR REPAIRS, &c., OF ENGINES AND BOILERS

(Received at London Office)

2 APR 1951

Date of writing Report 21/3 1951 When handed in at Local Office 19 Port of Rotterdam

No in Reg. Book. Survey held at Schiedam Date. First Survey and Last Survey 19/3 1951 (No. of Visits 1)

95817 on the Machinery of the Wood, Iron or Steel REG III in "Alaska"

Tonnage { Gross 5681 Vessel built at Panama By whom J. Coughlan & Sons When 1918 Month 7
 Net 3476 Engines made at Newcastle By whom Swan, Hunter (Wigham) Richards When 1924
 Nominal Horse Power 523MN Boilers, when made (Main) 1918 (Donkey)
 Owners Subsidiary of the Dutch Lumber Co. B.V. Owners' Address (if not already recorded in Appendix to Register Book.)
 No. of Main Boilers 353 Managers Helmut Timm & Co. Port Lamburg Voyage ✓
 No. of Donkey Boilers ✓ If Surveyed Afloat or in Dry Dock Wilton's
 Steam Pressure—190 lb (State name of Dock.)
 in Donkey Boilers ✓

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Years assigned expired	Machinery and Boiler Surveys (including date of N.B., if any)
<u>+100A1</u>		<u>LMC 7.48</u>
<u>Sub. 1.50</u>		<u>BS 2.49</u>
<u>Is Nuc. 2nd 11.13-11.13 TS</u>		<u>6.1.50</u>
<u>SS Bgm. -6.48</u>		<u>LINE 1.24</u>

Fitted for oil fuel 718.FP
above 150°F.

Last Report No. Port Condition

Particulars of Examination and Repairs (if any) Condition

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be briefly summarised at the end of the report. State also the dates and initials of any letters respecting this case)

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose, and why they were declined.

Was a damage report made by anyone else? If so, by whom?

Did the Surveyor personally go inside each Main Boiler separately and make a through examination at this time?

" " Donkey " " " "

If not, state for what reasons. What parts of the Boilers could not be thus thoroughly examined?

What special means, in the absence of internal examination, were adopted by the Surveyor to assure himself of the thorough efficiency of those parts of each Boiler?

State latest date of internal examination of each boiler. Present condition of funnel(s).

Did the Surveyor examine the Safety Valves of the Main Boilers? To what pressure were they afterwards adjusted under steam?

Did the Surveyor examine the Safety Valves of the Donkey Boilers? To what pressure were they afterwards adjusted under steam?

Did the Surveyor examine all the manholes, doors and their fastenings of the Main Boilers? and of the Donkey Boilers?

Did the Surveyor examine the drain plugs of the Main Boilers? and of the Donkey Boilers?

Did the Surveyor examine all the mountings of the Main Boilers? and of the Donkey Boilers?

Has the screw shaft now been drawn and examined? no Has it a continuous liner? ✓ Is an approved oil retaining appliance fitted at the after end?

Has shaft now been changed? ✓ If so, state reasons. Has the shaft now fitted been previously used? ✓ Has it a continuous liner?

Is an approved oil retaining appliance fitted at the after end? State date of examination of Screw Shaft. State the wear down in the stern bush 5 7/8 Is electric light and/or power fitted? ✓ If so, did the Surveyor examine the generators, motors, switchgear, cables and fuses?

Has the insulation resistance of the generators, circuits and apparatus been tested and found to be not less than 100,000 ohms?

Engine parts, when referred to by numbers, should be counted from forward. Auxiliary machinery should be referred to by position in Machinery Space.

If the Survey is not complete, state what arrangements have been made for its completion and what remains to be done.

Vessel placed in dry dock, propeller and outside fastenings examined

General Observations, Opinion, and Recommendation.—

(State clearly what alteration, if any, is suggested to be made in the existing classification of the vessel's machinery in the Register Book, consequent upon this survey, and also any alteration required to be made in the records of the vessel's machinery, boilers, working pressures, &c.; thus, for example, BS 0.11, B&MS 0.11, LMC 0.11 or LMC 140 lb., FD, &c.)

CS 3.34
Vessel to be continued as classed


Survey Fee (per Section 29) £ 1 : 0 : 0 Fees applied for 19
 Special Damage or Repair Fee (if any) £ 0 : 0 : 0 Received by me, 19
 (per Section 29.)
 Travelling expenses (if chargeable) £ 0 : 0 : 0

Committee's Minute

Assigned

TUES. 8 MAY 1951

See minute on

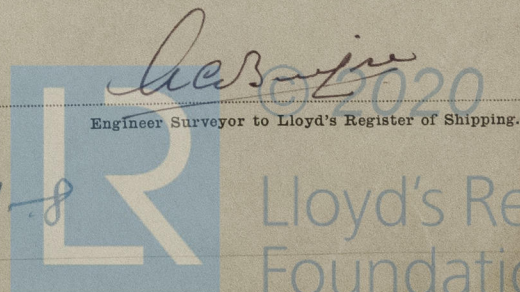

Lloyd's Register Foundation

009139-009143-0019