

DEC 23 1940

No. 99045

## REPORT OF SURVEY FOR REPAIRS, &amp;c.

Date of writing Report 16<sup>th</sup> Dec<sup>r</sup> 1940 When handed in at Local Office 17<sup>th</sup> Dec<sup>r</sup> 1940 Port of NEWCASTLE-ON-TYNE  
 No. in Reg. Book. Survey held at Wellington Quay-on-Tyne Date, First Survey 27 Nov Last Survey 13 Dec 1940  
49495 on the Wood, Iron or Steel S/S. "MICKLETON" (No. of Visits 2)

TONNAGE:— Built at Beverley By whom Book, Wilton & Gurnell Ltd When 1921 MONTH 8  
 GROSS 444 Owners Western Nav. Co Ltd Owners' Address (if not already recorded in Appendix to Register Book)  
 UNDER DK 541 Managers Wm S. Scott & Co Port belonging to HULL  
 NET 364

Surveyed Afloat or in Dry Dock? Slipway Name of Dock Glendale Destined Voyage

Cell DB or DBa feet; uE&B feet; f feet  
 total capacity tons. FPT tons; APT tons; MT feet tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

Last Report, No. 62526 Port Gls.

Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules and items remaining to complete the Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)

| CHARACTER.<br>* for Special Survey.<br>Date of last Survey and of<br>Periodical Surveys. | Machinery and Boiler<br>Surveys<br>(Including date of N.B., if any). |
|--|--|
| * 100 A.I.<br>11.38<br>S.S. Dwa. No. 3, 6.34<br>S.S. H.L. No. 1.38                       | * L.M.C.<br>M.S. 11.38<br>B.S. 6.40<br>C.L. 12.34                    |
| Cargo Batten<br>not fitted.  |  |

Society's Freeboard (if assigned) as painted on Ship and now verified } 3 ft. 1 1/2 ins.

Was a damage report made by anyone else? if so, by whom?

REPAIRS, OR EXAMINATION AS PER RULE, FOR CONDITION.

NOW DONE:— Vessel placed on Slipway. Bottom & Rudder cleaned, examined and re-coated. Hatchways, Hatches, Vents & Coamings examined. Decks, Casings and Girders generally examined.

WEAR & TEAR REPAIRS:— A number of Wood Hatch covers Renewed. Minor Repairs effected.

S.R.L. Indented Shell Plating midway of Bunkers (p.s.) examined & remains efficient

Annual Load Line Survey carried out at this time and Report forwarded.

| SUMMARY OF DAMAGE REPAIRS:—    | Shell Plates. | Frames. | R. Frames. | Floors and<br>Bracket Floors | Beams. | Inner Bottom<br>Plates. | Dk. Plates. | Other Items:— |
|--------------------------------|---------------|---------|------------|------------------------------|--------|-------------------------|-------------|---------------|
| Renewed                        |               |         |            |                              |        |                         |             |               |
| Removed and Faired or Repaired |               |         |            |                              |        |                         |             |               |
| Faired or Repaired in place    |               |         |            |                              |        |                         |             |               |

## PRESENT CONDITION OF THE

|  |   |  |   |
|--|---|--|---|
| Decks <u>Good</u>                                  | Bulkheads <u>where 2<sup>nd</sup></u>   | Engine Room Skylights <u>Good</u>            | Copper, or Y.M. <u>✓</u>                    |
| Plating of Decks <u>"</u>                          | Ceiling <u>✓</u>  | Coat Bunkers, Openings, Covers, &c. <u>"</u> | (State if on Fell.) <u>✓</u>                |
| Coamings <u>"</u>                                  | Cement or Asphalt <u>"</u>  | Oil Bunkers <u>"</u>                         | When fitted, Month <u>✓</u> Year <u>✓</u>   |
| Rams & Fastenings <u>where 2<sup>nd</sup></u>      | Rudder <u>Good</u>  | Scuppers <u>Good</u>                         | Boats <u>Good</u>                           |
| Outside Plating <u>"</u>                           | Steering gear and its connections <u>"</u>  | Cargo Hatchways <u>"</u>                     | Masts, Yards, &c. <u>"</u>                  |
| " in way of skylights <u>✓</u>                     | Windlass <u>"</u>   | Hatches <u>"</u>                             | Condition, how ascertained <u>from Deck</u> |
| Frames <u>where 2<sup>nd</sup></u>                 | Have pumps been examined and found efficient? <u>✓</u>                            | Planking <u>✓</u>                            | (State if wedges removed.)                  |
| Transverse Frames <u>✓</u>                         | Have Sluice Valves been examined and found efficient? <u>✓</u>                    | Caulking <u>✓</u>                            | Equipment letter <u>30-15</u>               |
| Longitudinals <u>✓</u>                             | Have Watertight Doors been examined and found efficient? <u>✓</u>                 | Treenails <u>✓</u>                           | Anchors, No. of <u>30-15</u>                |
| Transverses <u>✓</u>                               | Have Ventilators and their Coamings been examined and found efficient? <u>Yes</u> | Breasthooks & Stemson <u>✓</u>               | Cables (State if now ranged) <u>no</u>      |
| Decks <u>✓</u>                                     | Air and Sounding Pipes <u>✓</u>   | Transoms, Pointers & Crutches <u>✓</u>       | " length <u>Stake</u> mean diamr. <u>"</u>  |
| Elsons <u>✓</u>                                    | Doubling Plates under Sounding Pipes <u>✓</u>                                     | Timbers of Frame at openings <u>✓</u>        | (on board) <u>Complete</u> size <u>"</u>    |
| Rings <u>Good</u>                                  |   | " " at other places <u>✓</u>                 | Chain Locker <u>✓</u>                       |
| Inner Bottom Plating <u>no</u>                     |   | Stringers, Clamps & Shelves <u>✓</u>         | Hawsers & Warps <u>Good</u>                 |
| Have the Tanks been examined internally? <u>no</u> |   | Salting <u>✓</u>                             | Standing and Running Rigging <u>"</u>       |
| Have the Tanks been tested? <u>no</u>              |   | (State if examined.)                         | Sails <u>✓</u>                              |

## General Observations, Opinion as to Class, Recommendation, &amp;c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:— "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1.38," or "to remain as classed and to have record of survey, 1.38, and the notations of ss No. 1-38."

This Vessel is eligible in my opinion to remain as classed with fresh record of Survey 12.40. Subject to Indented Shell Plating midway of Bunkers (p.s.) being dealt with at Owners convenience.

Survey Fee (per Section 20) £

Special Damage or Repair Fee (if any) £

Surveying Expenses (if chargeable) £

and Surveyor's Fee (if any) £

Fees applied for,

10.

Received by me,

10.

H.E. Marshall


Surveyor to Lloyd's Register of Shipping.

Committee's Minute

TUE: 7 JAN 1941

Character Assigned

100 As Subject  
 S(N) 12.40 Cargo batten not fitted

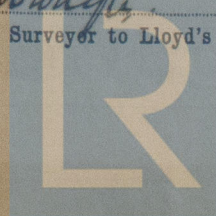

Lloyd's Register  
 Foundation

W59-0151