

Rpt. 8

REC'D NEW YORK JUL 12 1961

Port Miami

14 AUG 1961 No. 343

Date of writing Report July 9, 1961

When handed in at Local Office

Received London

Survey held at Miami, Fla.

No. of Visits 2

First Date and 19

Last Date July 3 1961

REPORT OF SHIP SURVEYS AND REPAIRS

(The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

No. in R.B. 82635

on the ~~Deck~~ ^{XXXX} Steel M.S.

TAMON MARU

Tons Gross 7714
Year 1954
Month 6

Built at Yokosuka

By whom Uruga Dock Co Ltd

When

Owners Hachiuma Kisen K.K.

Owner's address (If not already in R.B.) Nishinomiya

Managers

Port of Registry

Surveyed Afloat or in Drydock afloat

Name of Dock

Date of last examn. in Drydock

N.B.—Any alterations in existing particulars in the Register Book should be reported and underlined.

Last Report: No. 9058
To be filled in at Head Office.

Port Kol

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

SHIP'S CLASS Date of Special and of Drydocking Surveys, etc.	Machinery
*100A1	*LMC
docking 5/60	
SS 5/58	

Give dates and references to any letters relating to this Report.

In damage cases where the Surveyor has not made a special damage report he should state whether he offered his services for this purpose and to whom and why they were declined.

Freeboard as marked on ship and now verified ft. ins.

Was a damage report made by anyone else? If so, by whom?

EXAMINATION AND REPAIRS AS PER RULE FOR

This vessel arrived at Miami from New Orleans on July 3rd at 6:30 A.M. and was moored at 7:00 A.M. About 7:37 A.M. the M/V "BETTY K" struck the stern of the "TAMON MARU" while entering slip No. 1, Municipal Docks. An examination showed two indentations at the stern, both in hull space below steering engine, one on centerline over an area of about 2' x 3' and about 3" in depth, including buckling of centerline frame and starting of some vertical welding. The other indent was about 4 feet to starboard and several feet above the first, over an area of about 18" x 18" and a depth of 2". Centerline seam was rewelded on the outside for a distance of about 3 feet.

CONTINUATION OVER/OR SHEET 2

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates	Beams	Other Items
Renewed								
Removed and Faired or Repaired								
Faired or Repaired in place								

Has a Survey also been held on machinery of the Ship?

Is Classification Certificate required? If so, to be sent to

If so, is the Report sent now, or when will it be sent?

Has Interim Certificate been issued? yes

GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey, for example:—"to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1,55"; or to remain as Classed and to have record of drydocking 1,55, and the notation of S.S. . . . 1,55".

This vessel is eligible in my opinion to remain as Classed in the Register Book without fresh record of Survey subject to permanent repairs being effected at first opportunity. *k counter plating etc.*

Fred H. Hallbauer

Fred H. Hallbauer

Surveyor to Lloyd's Register of Shipping


NEW YORK JUL 12 1961

Date of Committee

Minute

As now Subject.

Noted for Header

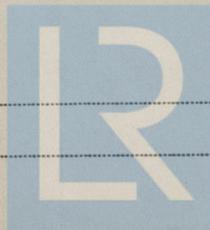

© 2021

Lloyd's Register Foundation

TABLE 1

PARTS OF THE SHIP AS INDICATED BELOW HAVE BEEN EXAMINED FOR SURVEY

Items	Now Examined YES NO or NONE	Tanks	Now Examined Internally	Now Tested
Shell plating, sternframe and rudder cleaned, examined and recoated in drydock		F.P. Tank		
Rudder lifted		A.P. "		
Weather Decks, Superstructures and Casings		D.B. Tanks (indicate Oil Fuel) and Cofferdams		
Hatchways, Covers, closing and securing appliances				
Ventilator coamings, skylights, companionways and closing appliances		Fresh Water Tanks		
Hold		Deep Tanks		
		Oil Fuel Bunkers and Settling Tanks		
Tween Decks		Side Tanks		
		Wing Tanks		
Fore Peak Spaces		Other Tanks		
After " "				
Engine Space		Cargo Tanks (Tankers)		
Boiler "				
Under Engines and Boilers				
Tunnel and Well		Cofferdams		
Coal Bunkers				
Chain Locker		Pump Rooms		
Other Spaces				
		Have Tanks now Examined been Cleaned as Necessary?		
		Have Struts in Cargo Tanks (of Tankers) been removed?		
		Have Tanks been Retested as necessary after completion of any Repairs?		

Have the spaces now surveyed been cleared and cleaned as necessary?
 Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?
 Have the bilges been cleaned out and examined? Has cement in bottom been examined?
 Has steelwork had rust removed and afterwards been recoated as necessary?
 Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?
 Has a Load Line Survey been held? If so, state which
 Have the shell and deck plating been drilled as per Rule? If so, Report 8(Dr) to be attached
 Have any alterations to the approved scantlings and arrangements now been effected? If so, report details in body of Report.

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word "Yes", e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

TABLE 2

The present condition of the following parts in so far as examined is to be reported:—

Shell plating	Ceiling and Cargo Battens	Sluice Valves examined and found	
" " in way of side scuttles	Cement or Asphalt	Air and Sounding Pipes	
Rudder and Sternframe	Cargo and other Hatchways	Doubling Plates under Sounding Pipes	
Decks	Hatches and closing appliances	Masts and Rigging examined and found	
Superstructures and their closing appliances	Ventilators, their coamings and closing appliances	Condition, how ascertained (State if wedges removed)	
Coamings and Casings	Companionways and Skylights	Chain Locker	
Beams and Fastenings	Shell Openings	EQUIPMENT	
Frames	Ash Shoots	Equipment Letter	Condition
Reverse Frames	Overboard Discharges and Scuppers	Anchor, No. of	Condition
Longitudinals	Freeing ports	Cables (State if now ranged and examined)	
Transverses	Steering Gear (Main and Auxiliary) examined and found	" length mean diam. (on board)	
Floors	Windlass examined and found	" Rule Length Size	
Keelsons	Pumps " " "	Hawsers and Warps	
Stringers	W.T. Doors " " "	State if any Anchors or Chain Cable have now been supplied or retested, if so, complete Report 8(Eq) and attach.	

Have conditions (A) or endorsements (B) of Class (if any) been dealt with? See Below

REMARKS, REPAIRS, Etc. (Contd.)

Survey Fee \$65.00
 Special Damage or Repair Fee (if any) 3.85
 Travelling Expenses (if chargeable)
 Second Surveyor's Fee (if any)
 Date when A/c. Rendered July 9, 1961

