

DISCLOSED  
REPORT of SURVEY for REPAIRS, &c.Date of writing Report 10/10/40 When handed in at Local Office 11<sup>th</sup> Oct 1940 Port of Kobe.  
No. in Survey held at Tama. Date, First Survey 10/9/40. Last Survey 9/10/1940.  
Reg. Book. (No. of Visits Five.)4746 27042 on the ~~Wood, Iron or Steel~~ S.S. "KOYO MARU".  
TONNAGE:- Built at Uraga. By whom Uraga Dock Co. Ltd. When 1919 6  
GROSS 5471 Owners Toyo Kisen Kabushiki Kai sha. Owners' Address  
UNDER DEK. 5036 (if not already recorded in Appendix to Register Book).  
NET 3287 Managers Port belonging to Yokohama.

Surveyed Afloat or in Dry Dock? Both Name of Dock Tama Dock. Destined Voyage

WB=Cell DBor DBa feet; uE&B feet; f feet  
total capacity tons. FPT tons; APT tons; MT feet tons.

Particulars of Classification (which must be inserted precisely as in Register Book &amp; Supplements)

CHARACTER.  
\* for Special Survey.  
Date of last Survey and of Periodical Surveys.\*100A1 5,39 \*LMC 5,39  
TS(CL) 5,39  
Fitted for oil fuel 6,19  
F.P. above 150°F.ssYka.No.3-7,32.  
ssNag.No.1-36.

Society's Freeboard (if assigned) as painted on Ship and now verified

Last Report, No. 1135 Port Kob.

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules and items remaining to complete the Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Was a damage report made by anyone else? If so, by whom?

REPAIRS, OR EXAMINATION AS PER RULE, FOR SPECIAL SURVEY 2nd No.2.

**NOW DONE:-** Vessel placed in dry dock. Hull, bottom, rudder (lifted) stern frame and stem cleaned, examined and found or now placed in good condition, afterwards recoated.

Holds, tween decks, fore and after peaks, and chain locker, spaces under bridge, engine and boiler space and coal bunkers cleared for survey, ceiling lifted as required by rules, oxidation removed and steel work throughout carefully examined and found or now placed in good condition, afterwards recoated.  
Lining on ship's side removed in way of sidelights and plating in way of same examined and found in good condition.

Ash shoots and plating under same examined and found in good condition.

(P.T.O.).

## SUMMARY OF DAMAGE REPAIRS:-

	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:-
Renewed								
Removed and Faired or Repaired								
Faired or Repaired in place								

## PRESENT CONDITION OF THE

Decks	Good	State if Tanks have been examined inside	Yes.	Air and Sounding Pipes	Good	Copper, or Y.M. of Wood Vessels	--
Caulking of Decks	"	State if Tanks now tested	Yes.	Dblg. Plates under Sounding Pipes	"	(State if on Belt.)	--
Coamings	"	Bulkheads	Good	Engine Room Skylights	"	When put on, Month	--
Beams & Fastenings	"	Ceiling	"	Coal Bunkers, Open'gs, Lids, &c.	"	Boats	Good
Outside Plating	"	Cement <del>Plating</del>	"	Oil Bunkers	"	Masts, Yards, &c.	"
" " in way of sidelights	Good	(State which.)	Good	Scuppers	Good	Condition, how ascertained	From aloft.
Breasthooks	"	Rudder	"	Cargo Hatchways	"	(State if wedges removed)	--
Transoms	"	Steering gear and its connections	"	Hatches	"	Sails	--
Frames	"	Windlass	"	Planking of Wood Vessels	--	Equipment letter	Z
Reverse Frames	"	Have pumps now been examined and found efficient?	Yes.	Caulking	ditto	Anchors, No. of	3B. 1S. 1K.
Longitudinals	--	Have Sluice Valves now been examined and found efficient?	--	Treenails	ditto	Chain Locker	Good
Transverses	--	Have Watertight Doors now been examined and found efficient?	Yes.	Breasthooks & Stemson	ditto	Cables (State if now ranged)	Yes. 9-1"
Floors	Good	Have Ventilators and their Coamings been examined and found efficient?	Yes.	Transoms Pointers, & Crutches	ditto	" length 270 fms. mean diamr. 2-16"	16
Keelsons	"			Timbers of Frame at openings	ditto	" Rule length 270 fms. size 2-4/16"	16
Stringers	"			Ditto Ditto at other places	ditto	Hawser & Warps	Good
Inner Bottom Plating	"			Stringers, Clamps & Shells	ditto	Standing and Running Rigging	"
				Salting	ditto		

## General Observations, Opinion as to Class, Recommendation, &amp;c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:- "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,24," or "to remain as classed and to have record of survey, 1,24, and the notations of ss No. 1-24."

This vessel is in good condition and eligible, in my opinion, to be continued as classed with fresh record of survey 10,40 and the Notation S.S. Kob. 2nd No.2-40.

Survey Fee (per Section 29) Yen 370:00  
Special Damage or Repair Fee (if any) (per Sec. 29) £ --  
Travelling Expenses (if chargeable) Yen 100:00  
(Including Machinery).  
Second Surveyor's Fee (if any) £

Fees applied for, 10/10/19 40

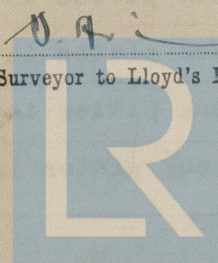
Received by me, 19

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Character Assigned

FRI. 16 MAY 1941

1004  
Fitted for oil fuel re  
S.S. No. 2-40  
Tama 10.40Lloyd's Register  
Foundation

010364-010377-0280 1/2



010369-010377-0280<sup>2</sup>/<sub>2</sub>