

Rpt. 8

Port LIVERPOOL

No. 157726

15 Nov. 1961

Date of writing Report 31.10.61 When handed in at Local Office Received London
No. of Visits 1 First Date 19. and Last Date 12.10.1961

Survey held at Liverpool

REPORT OF SHIP SURVEYS AND REPAIRS

(The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

No. in R.B. 36749 on the Iron or Steel M.S.S. Tug "WELLINGTON"
By Whom J. Cran & Somerville Ltd.
Bullt at Leith Owners Alexandra Towing Co. Ltd. Owners' address (If not already in R.B.) Liverpool
Managers Port of Registry Liverpool Date of last examn. in Drydock 12.10.61

Surveyed Afloat or in Drydock Drydock Name of Dock Clarence
N.B.—Any alterations in existing particulars in the Register Book should be reported and underlined.

Last Report: No. 20412 Port Liverpool
To be filled in at Head Office.

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

SHIP'S CLASS Date of Special and of Drydocking Surveys, etc.	Machinery
+ 100 A1 9,60 -	+ IMC 11,58
SS (Dr) 5,50 11,58	BS M 9,60
tug	TS OG 11,58
	s.p.s. 11,58
	ND

Give dates and references to any letters relating to this Report

In damage cases where the Surveyor has not made a special damage report he should state whether he offered his services for this purpose and to whom and why they were declined
Freeboard as marked on ship and now verified ft ins
Was a damage report made by anyone else? If so, by whom?

EXAMINATION AND REPAIRS AS PER RULE FOR Docking

It was noted that there were a number of minor indents on the side shell P & S and it is submitted that these be recorded in the S.R.L. Appendix:- "Indents in side shell plating (P & S)"

CONTINUATION OVER/OR SHEET 2

PRIMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates	Beams	Other Items
Renewed								
Removed and Fair'd or Repaired								
Red or Repaired in place								

Survey also been held on machinery of the Ship? Yes.
Is the Report sent now, or when will it be sent?

Is Classification Certificate required? If so, to be sent to
Has Interim Certificate been issued?

GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey; for example:- "to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1,55"; or "to remain as Classed and to have record of drydocking 1,55, and the notation of S.S. . . . 1,55".

This ship so far as now surveyed is eligible in my opinion to remain as classed with fresh record of P.S. 10/61.

Andrew A. Brock
Surveyor to Lloyd's Register of Shipping

Date of Committee

LIVERPOOL 14 NOV 1961

Minute

21.10.61

MBS 10.61



© 2021

Lloyd's Register Foundation

01394-013805-0192

TABLE 1

PARTS OF THE SHIP AS INDICATED BELOW HAVE BEEN EXAMINED FOR

SURVEY

Items	Now Examined	Tanks	Now Examined Internally	Now Tested
	YES NO or NONE			
Shell plating, sternframe and rudder cleaned, examined and recoated in drydock	yes	F.P. Tank		
Rudder lifted	no	A.P. "		
Weather Decks, Superstructures and Casings	yes	D.B. Tanks (indicate Oil Fuel and Cofferdams)		
Hatchways, Covers, closing and securing appliances	yes			
Ventilator coamings, skylights, companionways and closing appliances	yes	Fresh Water Tanks		
Hold	-	Deep Tanks		
'Tween Decks	-	Oil Fuel Bunkers and Settling Tanks		
Fore Peak Spaces	-	Side Tanks		
After " "	-	Wing Tanks		
Engine Space	-	Other Tanks		
Boiler "	-	Cargo Tanks (Tankers)		
Under Engines and Boilers	-			
Tunnel and Well	-	Cofferdams		
Coal Bunkers	-	Pump Rooms		
Chain Locker	-			
Other Spaces	-			
		Have Tanks now Examined been Cleaned as Necessary?		
		Have Struts in Cargo Tanks (of Tankers) been removed?		
		Have Tanks been Retested as necessary after completion of any Repairs?		

Have the spaces now surveyed been cleared and cleaned as necessary?

Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?

Have the bilges been cleaned out and examined? Has cement in bottom been examined?

Has steelwork had rust removed and afterwards been recoated as necessary?

Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?

Has a Load Line Survey been held? no If so, state which If so, Report 8(Dr) to be attached

Have the shell and deck plating been drilled as per Rule? If so, report details in body of Report.

Have any alterations to the approved scantlings and arrangements now been effected?

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word "Yes", e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

TABLE 2

The present condition of the following parts in so far as examined is to be reported:—

Shell plating <u>good</u>	Ceiling and Cargo Battens <u>-</u>	Sluice Valves examined and found <u>-</u>
" " in way of side scuttles <u>-</u>	Cement or Asphalt <u>-</u>	Air and Sounding Pipes <u>-</u>
Rudder and Sternframe <u>good</u>	Cargo and other Hatchways <u>good</u>	Doubling Plates under Sounding Pipes <u>good</u>
Decks <u>good</u>	Hatches and closing appliances <u>good</u>	Masts and Rigging examined and found <u>good</u>
Superstructures and their closing appliances <u>good</u>	Ventilators, their coamings <u>-</u>	Condition, how ascertained <u>from deck</u>
Coamings and Casings <u>good</u>	and closing appliances <u>good</u>	(State if wedges removed)
Beams and Fastenings <u>-</u>	Companionways and Skylights <u>good</u>	Chain Locker <u>-</u>
Frames <u>-</u>	Shell Openings <u>-</u>	EQUIPMENT
Reverse Frames <u>-</u>	Ash Shoots <u>-</u>	Equipment Letter <u>(d)</u>
Longitudinals <u>-</u>	Overboard Discharges and Scuppers <u>-</u>	Anchors, No. of <u>2B</u> Condition <u>not examined</u>
Transverses <u>-</u>	Freeing ports <u>good</u>	Cables (State if now ranged and examined) <u>no</u>
Floors <u>-</u>	Steering Gear (Main and Auxiliary) <u>-</u>	" length <u>stated</u> mean diam. <u>-</u>
Keelsons <u>-</u>	examined and found <u>good</u>	" (on board)
Stringers <u>-</u>	Windlass examined and found <u>good</u>	" Rule Length <u>complete</u> Size <u>-</u>
Inner Bottom Plating <u>-</u>	Pumps " " <u>-</u>	Hawsers and Warps <u>Sufficient</u>
Bulkheads and Tunnel <u>-</u>	W.T. Doors " " <u>-</u>	State if any Anchors or Chain Cable have
		now been supplied or retested, if so
		complete Report 8(Eq) and attach.

Have conditions (A) or endorsements (B) of Class (if any) been dealt with? no See Below

REMARKS, REPAIRS, Etc. (Contd.) S.R.L. No. 184 - Nil


S.R.L. Appendix No. 8 :- Nil

CMZ

Survey Fee -

Special Damage or Repair Fee (if any) -

Travelling Expenses (if chargeable) -

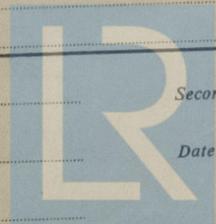

© 2021

Second Surveyor's Fee (if any) -

Date when A/c. Rendered -

Lloyd's Register Foundation

... Certificate
... while the
... derstood that
... accuracy any
... for any error
... the Society.

rt. B) 130n