

Report of Survey for Repairs, &c., of Engines and Boilers.

(Received at London Office)

Date of writing Report 5. 12. 93 18 18 When handed in at Local Office 18 Port of London

No. in Reg. Book. Survey held at London Date, First Survey 7 Last Survey Nov. 29 1893
6 on the Machinery of the Wood, Iron or Steel S. S. "Dabulamauzi" Master

Tonnage { Gross 1537 Vessel built at Abdn. By whom Hall Russell & Co. When 1882 - 5
Net 980

Registered Horse Power 200 Engines made at do When 1888 Boilers, when made (Main) 1888 (Donkey)
No. of Main Boilers 2 Owners J. J. Rennie & Son Port Aberdeen Voyage
Steam Pressure in Main Boilers 160 lbs Surveyed Afloat or in Dry Dock Union
in Donkey Boiler

Last Survey No. Port

Particulars of Examination and Repairs (if any) London:

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be briefly summarised at the end of the report. State also the dates and initials of any letters respecting this case.)

CHARACTER, * for Special Survey, Date of last Survey and of Periodical Surveys.	Years Assigned how expired.	Machinery and Boiler Surveys (including date of N.B., if any).
-1-100 A 1 1. 93 S.S. Lon: no 2-90	"span dk"	-1-L.M.C. 5.90 -1-X.B. 10.88

Did the Surveyor personally go inside each Main Boiler separately and make a thorough examination at this time?
Do. " Donkey " " " "

If this was not done, state for what reasons?

And what parts of the Boilers could not be thus thoroughly examined?

Also what special means, in the absence of internal examination, were adopted by the Surveyor to assure himself of the thorough efficiency of those parts of each Boiler?

Did the Surveyor examine the Safety Valves of the Main Boiler?

At what pressure were they afterwards adjusted under steam?

Did the Surveyor examine the Safety Valves of Donkey Boiler?

To what pressure were they afterwards adjusted?

If the Survey is not complete state what arrangements have been made for its completion?

Vessel placed in dry dock, sea combrs: xrd: found in good condn. the propeller & its fastenings sound, & the tail shaft a good fit in stern bush.

General Observations, Opinion, and Recommendation:— As far as seen this vessel
(State clearly what alteration, if any, is suggested to be made in the existing classification and notification of the vessel's machinery in the Register Book, consequent upon this survey: thus, for example, B.S. 9,92, B.&M.S. 9,92 or L.M.C. 9,92, as the case may be.)


apprs. eligible to remain as classed

Office or Registration Fee (per Sec. 27)	£ : :	Fees applied for
Survey Fee (per Section 28)	£ ✓ : ✓ :	
Special Damage Fee (per Section 28)	£ : :	
Travelling Expenses (if chargeable)	£ : :	
Received by me,		18

Geo. E. Wilkinson
Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

State if Certificate is required
Committee's Minute FR 8 DEC 1893

Assigned As now

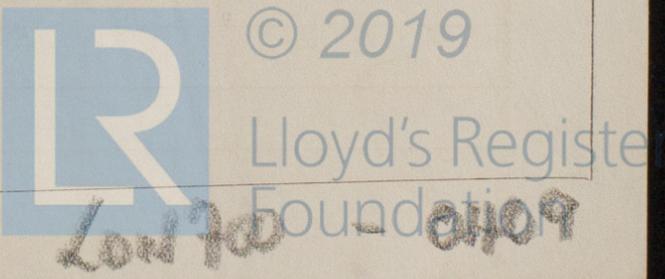

as in Report or if not attach

Insert Character of Ship and Machinery precisely as in the Register Book.

It is submitted that
this vessel is eligible
remain AS CLASSED.

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or cause it to show through to the other side.

Prob
6/12/93 -

Completed
When it ceases
When it ceases
When it ceases
When it ceases

COGNAC



© 2019

Lloyd's Register
Foundation

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.