

Report of Survey for Repairs, &c., of Engines and Boilers.

Date of writing Report 18 When handed in at Local Office 18 Port of London
No. in Reg. Book. Survey held at London Date, First Survey 7 Last Survey Jan. 10 1895
671 on the Machinery of the Wood, Iron or Steel S. S. City of London Master
Tonnage Gross 357 Net 182 Vessel built at Nur By whom Schlemmer, Davis & Co When 1891 - 12
Registered 50 Engines made at do When 1891 Boilers, when made (Main) 1891 (Donkey)
No. of Main Boilers 1 Owners D. C. Thomas & Sons Port London Voyage
No. of Donkey Boilers 1
Steam Pressure in Main Boilers 160 lbs. N Surveyed Afloat or in Dry Dock Union
in Donkey Boilers 80 (State name of Dock.)

Last Survey No. Port
Particulars of Examination and Repairs (if any) Condition

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be briefly summarised at the end of the report. State also the dates and initials of any letters respecting this case.)

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Year Assigned now expired.	Machinery and Boiler Surveys (including date of N.B., if any).
-100 A1 12. 94		-LMC 12. 91


Did the Surveyor personally go inside each Main Boiler separately and make a thorough examination at this time?
Do. " Donkey " " "
If this was not done, state for what reasons?
And what parts of the Boilers could not be thus thoroughly examined?
Also what special means, in the absence of internal examination, were adopted by the Surveyor to assure himself of the thorough efficiency of those parts of each Boiler?
Did the Surveyor examine the Safety Valves of the Main Boiler?
At what pressure were they afterwards adjusted under steam?
Did the Surveyor examine the Safety Valves of Donkey Boiler?
To what pressure were they afterwards adjusted?
If the Survey is not complete state what arrangements have been made for its completion?

Vessel placed in dry dock, sea counter, exd. & found in good condtn.
the propeller & its fastenings sound, & the tail shaft a good fit in stern bush

General Observations, Opinion, and Recommendation:— As far as seen this vessel
(State clearly what alteration, if any, is suggested to be made in the existing classification of the vessel's machinery in the Register Book, consequent upon this survey, and also any alteration required to be made in the records of the vessel's machinery, boilers, working pressures, &c.: thus, for example, B.S. 4, 91, B.&M.S. 4, 91 or L.M.C. 4, 91, 140 lb., F.D., &c.)
appears eligible to remain as classed.

Office or Registration Fee (per Sec. 27)	£	:	:	Fees applied for
Survey Fee (per Section 28)	£	✓	✓	18
Special Damage Fee (per Section 28)	£	:	:	Received by me,
Travelling Expenses (if chargeable)	£	:	:	18

*State if Certificate is required.
Committee's Minute FRIDAY, 1 FEB 1895
Assigned As now
Geo. E. Wilkinson
Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

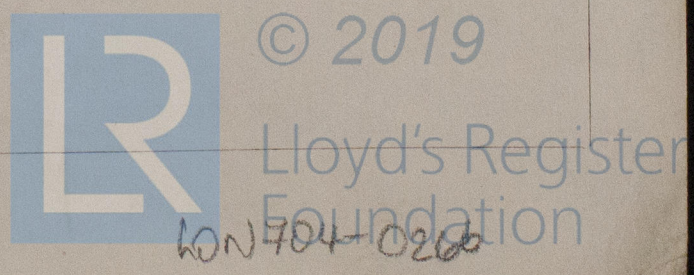

It is submitted that
this vessel is eligible to
remain AS CLASSED.

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or cause it to show through to the other side.

ARK
29.1.95

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.



© 2019

Lloyd's Register
Foundation