

Report of Survey for Repairs, &c., of Engines and Boilers.

(Received at London Office TUES. MAY 26 1896)

Date of writing Report 21st May 1896 When handed in at Local Office 21/5 1896 Port of London

No. in Ref. Book. 81 Survey held at London Date, First Survey 12th May Last Survey 21st May 1896
on the Machinery of the Wood, Iron or Steel S. S. Gorth Castle Master A. Rendall

Tonnage Gross 7105 Net 2381 Vessel built at Glasgow By whom J. Plean & Co When 1880 12
Registered Horse Power 600 Engines made at Wood When '88 Boilers, when made (Main) (Donkey)
No. of Main Boilers 3 Owners S. Currie & Co Port London Voyage Ile de Manin

No. of Donkey Boilers 1 Steam Pressure in Main Boilers 150 lb If Surveyed Afloat or in Dry Dock Afloat in India Dock Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).
in Donkey Boilers 80 (State name of Dock.)

Last Survey No. 1777 Port London
Particulars of Examination and Repairs (if any) Repairs

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be briefly summarised at the end of the report. State also the dates and initials of any letters respecting this case.)

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Years Allowed to elapse.	Machinery and Boiler Surveys (including date of N.B., if any).
<u>100 A. 1. '96.</u>		<u>Thuc. 6. 92</u>
<u>1. 1. 96. 103. 4. 93.</u>		<u>BS. 10. 95</u>
		<u>1. 1. 88.</u>

Did the Surveyor personally go inside each Main Boiler separately and make a thorough examination at this time?
Do. " Donkey " " "

If this was not done, state for what reasons?

And what parts of the Boilers could not be thus thoroughly examined?

Also what special means, in the absence of internal examination, were adopted by the Surveyor to assure himself of the thorough efficiency of those parts of each Boiler?

Did the Surveyor examine the Safety Valves of the Main Boiler?

At what pressure were they afterwards adjusted under steam?

Did the Surveyor examine the Safety Valves of Donkey Boiler?

To what pressure were they afterwards adjusted?

Has the propeller shaft been drawn and examined at this time? No.

If the Survey is not complete state what arrangements have been made for its completion? Survey complete.

Now done: a new crank shaft supplied and fitted in place. Works in name: Lloyd's 421. S. S. S.

Please see Forging Report attached.

General Observations, Opinion, and Recommendation:—

(State clearly what alteration, if any, is suggested to be made in the existing classification of the vessel's machinery in the Register Book, consequent upon this survey, and also any alteration required to be made in the records of the vessel's machinery, boilers, working pressures, &c.: thus, for example, B.S. 9,95, B.&M.S. 9,95 or L. M.C. 9,95, 140 lb., F.D., &c.)
So far as has been seen the machinery of this vessel is in good condition and, in my opinion, eligible to remain as classed without fresh record.

	£	s	d	Fees applied for
Office or Registration Fee (per Sec. 27)				18
Survey Fee (per Section 28)				
Special Damage Fee (per Section 28)				
Travelling Expenses (if chargeable)				
Received by me,				18

R. Ricketts
Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.


*State if Certificate is required
Committee's Minute TUES. JUN 2 1896

Assigned As now
made LN

State if a Report is also now sent on the Ship or if not whether, and when, one will be sent.

Certificate to be sent to
The Surveyors are requested not to write on or below the space for Committee's Minute.

Insert Character of Ship and Machinery precisely as in Register Book.

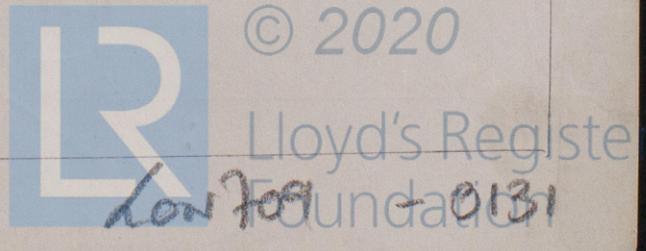

Cause not stated. A new crank shaft fitted.

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or cause it to show through to the other side.

It is submitted that
this vessel is eligible to
remain AS CLASSED.

Emd.
1.6.96.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.



© 2020

Lloyd's Register
Foundation