

Report of Survey for Repairs, &c., of Engines and Boilers.

(Received at London Office

THUR. 28 DEC 1899

Date of writing Report *23rd Decr* 18 *99* When handed in at Local Office *23rd Decr* 18 *99* Port of *London*

No. in Reg. Book *122* Survey held at *London* Date, First Survey *8th Decr* Last Survey *2nd Decr 89*

on the Machinery of the Wood, Iron or Steel *S. S. Venus* Master *Marshall*

Tonnage { Gross *3556* Net *231 2* Vessel built at *Glasgow* By whom *Richard & Co* When *1896* 8

Registered Horse Power *294* Engines made at *Glasgow* When *'96* Boilers, when made (Main) *'96* (Donkey) *'96*

No. of Main Boilers *2* Owners *J. L. Lorie* Port *A. C. C.* Voyage

No. of Donkey Boilers *1* Steam Pressure in Main Boilers *160 lb* If Surveyed Afloat or in Dry Dock *Afloat in Dry Dock* Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

CHARACTER. ☒ for Special Survey. Date of last Survey and of Periodical Surveys. Years Assigned and expired. Machinery and Boiler Surveys (including date of N.B., if any).

Last Survey No. Port

Particulars of Examination and Repairs (if any) *Damage. + 100 Al. 1. 99 + L.M.C. 8. 96*

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be briefly summarised at the end of the report. State also the dates and initials of any letters respecting this case.)

Did the Surveyor personally go inside each Main Boiler separately and make a thorough examination at this time?

Do. " Donkey " "

If this was not done, state for what reasons?

And what parts of the Boilers could not be thus thoroughly examined?

Also what special means, in the absence of internal examination, were adopted by the Surveyor to assure himself of the thorough efficiency of those parts of each Boiler?

Did the Surveyor examine the Safety Valves of the Main Boiler?

To what pressure were they afterwards adjusted under steam?

Did the Surveyor examine the Safety Valves of Donkey Boiler?

To what pressure were they afterwards adjusted under steam?

Has the propeller shaft been drawn and examined at this time? *yes.* If spare propeller shaft fitted, state whether new?State the distance between lignum vitae of stern bush and top of after bearing of screw shaft? *18.*If the Survey is not complete state what arrangements have been made for its completion and what remains to be done? *complete.*

Good done in account of Damage, please see copy of Damage Report herewith.

The vessel placed in dry dock. Tail shaft drawn in and with crank. Thrust and Journal Shafting. Propeller and Stern-bush examined.

Repairs: Two new Coupling Bolts fitted to the Tail Shaft.

General Observations, Opinion, and Recommendation:—

(State clearly what alteration, if any, is suggested to be made in the existing classification of the vessel's machinery in the Register Book, consequent upon this survey, and also any alteration required to be made in the records of the vessel's machinery, boilers, working pressures, &c.: thus, for example, B.S. 9,97, B.&M.S. 9,97 or L.M.C. 9,97, 140 lb. F.D., &c.)

The Machinery of this vessel as now seen, is in good order and in my opinion eligible to remain as classed. Without fresh record.

Office or Registration Fee (per Sec. 27) £ : :

Survey Fee (per Section 28) £ : :

Special Damage Fee (per Section 28) £ 3 : 3 :

Travelling Expenses (if chargeable) £ 2 : 17 -

State if Certificate is required

Committee's Minute

Assigned *as now*


Fees applied for

29/12/99

Received by me, *J. L. Lorie*

9/1/1900

Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

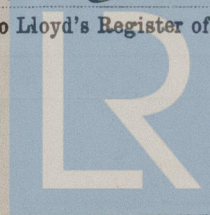

Lloyd's Register Foundation

LON720-0261

on acc. of damage by stress of weather:-

Screw shaft examined.
all shafting examined

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

It is submitted that
this vessel is eligible to
remain as CLASSED.

CW.
29.12.99

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.



© 2019

Lloyd's Register
Foundation