

## REPORT OF SURVEY FOR REPAIRS, &amp;c.

Date of writing Report.....19.....

When handed in at Local Office.....2 SEP 1940

Port of 1000No. in  
Reg. Book.Survey held at 1000Date, First Survey 1.8.40Last Survey 24.8.1940

(No. of Visits)

78825 on the Wood, Iron or SteelS.S. "MALRIX"

TONNAGE:-

Built at 1000By whom 1000

YEAR.

MONTH.

GROSS

703Owners 1000

Owners' Address

When 1923-6

UNDER DK.

478Managers 1000Port belonging to 1000

Surveyed Afloat or in Dry Dock?

Name of Dock 1000Destined Voyage 1000

U.D. or D.B.

feet; uE&amp;B

feet; f

feet

al capacity

tons. FPT

tons; APT

tons; MT

feet

tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

Last Report, No. 50694Port 1000

Particulars of Classification (which must be inserted precisely as in Register Book &amp; Supplements)

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Machinery and Boiler Surveys (Including date of N.B., if any).
<u>1000</u>	<u>1000</u>
<u>1000</u>	<u>1000</u>
<u>1000</u>	<u>1000</u>
<u>1000</u>	<u>1000</u>
<u>1000</u>	<u>1000</u>

Damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Society's Freeboard (if assigned) as painted on Ship and now verified 3 ft. 92 ins.

Was a damage report made by anyone else? if so, by whom?

PAIRS, OR EXAMINATION AS PER RULE, FOR

COMPUTING OF SPECIAL SURVEY 2ND. PER. 1.

NOV. DONE. An examination has now been made of the cargo hatchways, beams, platings, wood battens, tarpaulins, clots & battening arrangements, ventilators & platings, air & sounding pipes, their closing apparatus, coverings, doors & fastenings, skylights, sliding openings & their closing apparatus, gunning ports & shutters, guard rails, lifelines, sanitary discharge pipes & valves, steel decks, boat ladders, & other peak tank internalities.

The freeboard markings have been verified & the new load line certificate & copy forwarded to the Bureau.

See Continuation Sheet.

ARY OF DAMAGE REPAIRS:-

Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:-
Renewed							
Removed and Faired or Repaired							
Faired or Repaired in place							

INT CONDITION OF THE

g of Decks	<u>good</u>	Bulkheads	<u>good</u>	Engine Room Skylights	<u>good</u>	Copper, or Y.M.	<u>good</u>
gs	<u>good</u>	Ceiling	<u>good</u>	Coal Bunkers, Openings, Covers, &c.	<u>good</u>	(State if on Fett.)	<u>good</u>
& Fastenings	<u>good</u>	Cement or Asphalt	<u>good</u>	Oil Bunkers	<u>good</u>	When fitted, Month	<u>good</u>
Plating	<u>good</u>	Rudder	<u>good</u>	Scuppers	<u>good</u>	Year	<u>good</u>
in way of sidelights	<u>good</u>	Steering gear and its connections	<u>good</u>	Cargo Hatchways	<u>good</u>	Boats	<u>good</u>
Frames	<u>good</u>	Windlass	<u>good</u>	Hatches	<u>good</u>	Masts, Yards, &c.	<u>good</u>
dinals	<u>good</u>	Have pumps been examined and found efficient?	<u>good</u>	Planking	<u>good</u>	Condition, how ascertained	<u>good</u>
rses	<u>good</u>	Have Sluice Valves been examined and found efficient?	<u>good</u>	Caulking	<u>good</u>	(State if wedges removed.)	<u>good</u>
Bottom Plating	<u>good</u>	Have Watertight Doors been examined and found efficient?	<u>good</u>	Treenails	<u>good</u>	Equipment letter	<u>good</u>
Tanks been examined internally	<u>good</u>	Have Ventilators and their Coamings been examined and found efficient?	<u>good</u>	Breasthooks & Stemson	<u>good</u>	Anchors, No. of	<u>good</u>
Tanks been tested	<u>good</u>	Air and Sounding Pipes	<u>good</u>	Transoms, Pointers & Crutches	<u>good</u>	Cables (State if now ranged)	<u>good</u>
	<u>good</u>	Doubling Plates under Sounding Pipes	<u>good</u>	Timbers of Frame at openings	<u>good</u>	length (on board)	<u>good</u>
	<u>good</u>		<u>good</u>	Stringers, Clamps & Shelves	<u>good</u>	Rule length (complete)	<u>good</u>
	<u>good</u>		<u>good</u>	Salting	<u>good</u>	Chain Locker	<u>good</u>
	<u>good</u>		<u>good</u>	(State if examined.)	<u>good</u>	Hawsers & Warps	<u>good</u>
	<u>good</u>		<u>good</u>		<u>good</u>	Standing and Running Rigging	<u>good</u>
	<u>good</u>		<u>good</u>		<u>good</u>	Sails	<u>good</u>

General Observations, Opinion as to Class, Recommendation, &amp;c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:— "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

Ugile in my opinion T. remain as classed without

fresh record of Survey & T. have the notation

S.S. HVL. 2ND. 17.1-39 as previously recommended.

Survey Fee (per Section 29).....£

Fees applied for,

Special Damage or Repair Fee (if any).....£

19.....

Selling Expenses (if chargeable).....£

Received by me,

and Surveyor's Fee (if any).....£

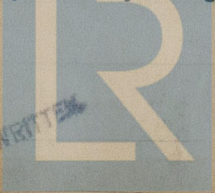
19.....

Committee's Minute

Character Assigned

100 A1Cargo Bats not fitS.S. No. 1-404 Lmc 9.39BS 8.40

Surveyor to Lloyd's Register of Shipping.

Lloyd's Register  
Foundation

W49-0097 (2/2)



HULL

Continuation of Report No. 50834, dated 24-8-40 on

on the

S. L. MALRUX.

The expired Certificate & Copy are returned herewith for cancellation.

The following repairs, some of which were previously recommended in Hull Report No. 11, have now been carried out & the vessel placed in good condition.

REPAIRS (TO OWNERS A/c)

After each Tank:

10 W.T. Luskhead Pittman removed.

10 " " " " Vachit removed

2 for aft bulkhead stiffener & brackets removed.

5-1000 leaves removed

2 for 6 a/v beams removed.

2' Rock plates over Tank removed

Burrows:

2 Silver Bullhead Pi-fishers removed.

6 Ladders Carving <sup>4</sup> Piffener Baskets removed

The 1st & 2nd Buckhead Meadows Locality

*R. H. P.*