

Ship's Name SS/~~MS~~ "ILYASBAKSH"

Gross tons 7081

Is there a rpt. 8? Yes Port Bombay Rpt. No. 16887

No. of visits Ten First date 21-8-65 Last date 17-9-65

Interim Cert. issued &amp; copy herewith? Yes Damage rpt. issued &amp; copy herewith? No Last rpt. (H.Q. only)

Date of completing rpt. 17-1-66 Surveyed at, if different from Port above

Is a rpt. 9A attached? No MN Nature of survey Commencement MBS &amp; DKG.

Survey fees Damage fee Expenses Rs.150/-

MBS: Rs.1170/-

DKG: Rs.140/-

S.A. fee

## DOCKING

Propeller Good

Sea connections -

Oil gland

Fastenings Good

Wear down of stern bush 5/32

Has screw/tube shaft been drawn? No

Date of examn.

Has shaft been changed?

Has shaft now fitted been previously used?

Has shaft now examined/fitted a continuous liner?

Approved oil gland?

BOILERS OPENED UP AND EXAMINED. (Identify by position and state latest date of internal examination of each boiler.)

AUXILIARY, DONKEY OR PRESS (State if oil fired—OF or exhaust gas—EG)

MAIN

Centre - 21-3-65 - Good

Port - 31-8-65 - Good

Starbd.- 1-9-65 - Good

Centre, Port, Starbd. - Good

Centre, Port, Starbd. - Good

Centre, Port, Starbd. - Good

Centre, Port, Starbd.-- Good

Air heaters

Superheaters

Safety valves

Mountings, doors and fastenings

Safety valves { Sat adjusted to { Spt

Not adjusted

Not adjusted

Boiler securing arrangements

Centre, Port Starbd. - Good

Main economisers

Steam heated steam generators

Forced circulating pumps

Exhaust gas heated economisers

Steam generator safety valves adjusted to

Funnel Good

Have saturated steam pipes in cylindrical boiler smoke boxes been examined as required by the Rules? Yes-Good Were oil burning system &amp; remote controls examined in accordance with rules? No

I recommend that the machinery of this ship remain as classed with/without fresh record of

MBS 8-65 when the survey is complete subject to any outstanding conditions of class being dealt with as previously recommended.

ALSO FOR

SPL FOR

TRO

SRL

POSTING

HEADER

CERT

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

(S.R.Khare)

Surveyor to Lloyd's Register of Shipping

Date of Committee

Minute

WEDNESDAY 9 MAR 1966

Deferred for CP. MBS. Subject.

Lloyd's Register Foundation

014276-014286-0184

At part or complete Special Surveys those items which are not applicable to the ship are to be cancelled; this need not be done when the machinery is on a continuous survey basis. When any part has been subjected to pressure test this should be stated. Engine parts when referred to by numbers should be counted from forward.

considered that re-examination or repairs should be made before that date a distinguishing mark must be inserted against the item and the circumstances and action taken or recommended described fully under "defects and repairs".

The condition of any item is to be described as "good" only when it has been examined, found or placed in good condition, and is considered to be acceptable until the due date of the next Periodical Examination. Where repairs have been effected or it is



# EXAMINATION AND TESTING OF STEAM PIPES (state material)

MAIN  
AUXILIARY  
(over 3" bore)

Have saturated pipes in cylindrical boiler smoke boxes been tested ?

Were selected copper pipes annealed ?

## ELECTRICAL EQUIPMENT

PROPULSION (State Port—P, or Starboard—S)		AUXILIARY	
Total kW or kVA		Total kW or kVA	
a Generators		l Generators & governors	
b Exciters			
c Air coolers		m Motors	
d Motors			
e Air coolers		n Switchboards & fittings	
f Control gear cables, etc.		o Circuit breakers	
g Insulation resistance		p Cables	
h Insulating oil test		q Insulation resistance	
i Overspeed governors		r Steering gear generators & motors	
j Magnetic couplings		s Navigation light indicators	
k Air gap			

## PARTICULARS OF DEFECTS, REPAIRS, ALTERATIONS, ETC.

Centre Boiler - Gauge glass cocks renewed.

Aux. feed check valve spindle renewed.

Blowdown valve lid renewed and a false seat put  
in the body. Superheater VV spindle renewed.

Starboard Boiler: 3 c.c. stays renewed.

Superheater safety valve lid renewed.

Scum valve lid renewed.

Aux. stop valve seat renewed.


Main feed check valve lid renewed.

Port Boiler :

Superheater safety valve lid renewed.

Internal feed pipe renewed.

The reason for repairs must be stated and those on account of damage, the alleged cause of which must be given, should be detailed separately from wear and tear repairs. State what action has been taken regarding items which are subjects of class. State also where appropriate, for the information of the Technical Records Dept., the material of the defective item and whether it is a forging, casting or welded fabrication. Any alterations in existing particulars in the Register Book should be reported above.

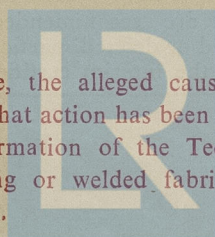

© 2021

Lloyd's Register  
Foundation