

m.v. "BEECEELITE".

Carrying Petroleum in Bulk.

Montreal Report No.4609.  
-----

IT IS SUBMITTED the New York Office be informed with reference to the electrical installation their attention is drawn to the following points and their comments are awaited.

(1) Plans of the installation have not been received at this Office as required by the Rules.

(2) It is not clear from the Report whether the automatic governors on the auxiliary dynamo engines have been tested and found efficient when the whole load is suddenly thrown off.

(3) The fall of pressure is not stated.

(4) The main generators are rated 250 volts; Section 15 specifies a maximum of 220 volts for tankers.

(5) It is not stated whether the generator and motor cables are lead covered as required by Section 15.


(6) Test certificates for the motors have not been furnished as required by Section 11, Clause 2.

(7) The di-electric test on the 40 Kw. generators has been taken at 1500 volts instead of 2000 volts as required by the Rules.

(8) Test certificates for the 5 and 15 Kw. generators have not been received.

*L-15/2*

*sd* *Row*  
10th February, 1938.  
*WJ*

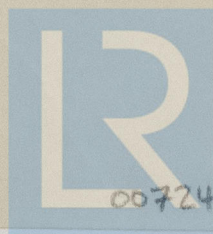

© 2021

Lloyd's Register  
Foundation

007246-007256-0305