

Ship's Name ~~SS/MS~~ "ZURRIOLA"

Gross tons 2078

Is there a rpt. 9? **Yes**Port **BARCELONA**

Rpt. No. 7982

No. of visits 2

First date **11-4-64**Last date **14-4-64**Interim Cert. issued
& copy herewith? **Yes**Damage rpt. issued
& copy herewith?Last rpt. (H.Q. only) **BCL 7773**Date of
completing rpt. **20-5-64_a**

Surveyed at, if different from Port above

Surveyed afloat
and/or in D.D. **Drydock**Last date of examination in D.D. **14-4-64**Has a Load Line
Survey been held?

Freeboard Marks verified

State which additional Rpt. 8 is attached: (Cont); (PS); (DR); (EQ); (Rig)

Survey fees

DS. 875,-

Damage fee

Expenses

80,-

Drilling 800,-

S.A. fee

I have surveyed the above ship in accordance with the Rules for DRYDOCKING

Drydocking carried out in accordance with report 8 (PS) attached.

The items now surveyed are detailed on this report. All were found or placed in good condition unless otherwise stated.

When carrying out the dry dock survey it was observed that the main deck plates were in general wavy, and when hammer tested sounded thin.

It was recommended all main deck plates be drill tested, as the result of which it was found that approximately 80% of the deck plates were below minimum thickness and in some cases 2.1 mm. 3 mm. and 3.1 mm. etc.

It was recommended that all main deck plates at or below minimum thickness be renewed.

The Owners have now stopped all work on the vessel pending a decision to sell the vessel for breaking up.

It is recommended that the class of this vessel be suspended until the main deck is repaired.

We recommend that this ship remain as classed with/without fresh record of dry docking the class of this vessel be suspended until the main deck is repaired.

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

Surveyor to Lloyd's Register of Shipping

Date of Committee **FRIDAY - 3 JUL 1964** R. W. Stonehouse & J. Alday

GENERAL COMMITTEE
Minute

30th July '64. Class will remain
Classing Committee's
decision confirmed.

ALSO FOR

SPL FOR

TRO

SRL

POSTING

HEADER

CERT

503/NDP-8

12 JUN 1964

011047-011056-0215 1/2

Received by [Signature]
Surveyor to Lloyd's Register of Shipping

Lloyd's Register
Foundation

Rpt. 8 (P.S.) DRY CARGO SHIP

Ship's Name SS/MS "ZURRIOLA"

S.S. () Due


Port Barcelona

Rpt. No. 7982

	<u>Examined & condition</u>	<u>Examined & condition</u>
In dry dock from	11-4-64	* Air & sounding pipes (above deck) Good
.. .. to	26-4-64	Doublers under Not examined
Shell plating	Good	Steering arrangements (main) Good
Sternframe	Good (aux) Good
Rudder	Good	Windlass Good
Was rudder lifted?	No	Masts & rigging (from deck) Good
Plating, etc. in way of shell openings	Good	Hand pumps & suction Not examined
Side scuttles & deadlights	Not	W.T. doors Not examined
Overbd. scuppers & discharges	Good	Bulwarks, freeing ports, etc. Good
F.P. spaces	Not examined	Summer freeboard as verified -
Chain locker	Not examined	
A.P. spaces	Not examined	
Engine space	Not examined	
Boiler space	Not examined	<u>EQUIPMENT:</u>
Under E. & B.	Not examined	Equipment letter "r"
Coal bunker	Not examined	Fee ltr., if diff. from eqpt. ltr. -
Tunnel & well	Not examined	Anchors: No. on board 3 Bowers
Cement, asphalt, etc., on btm. shell	Not examined	State if ranged Not ranged
Weather decks	Very wasted +	Length on board Stated, complete
* Casings	Good	Mean dias. range from - to -
* Deckhouses	Good	Rule length 440 mts. Dia. 44.5 mm.
* Superstructures	Good	Mooring ropes Sufficient.
* Skylights	Good	
* Companionways	Good	
* Hatchways	Good	
* Ventilators	Good	
Other items:		

* These items to include their closing appliances

Where a part Special Survey and, say, Dry Docking Survey are held at the same time, the items for SS should be marked "For SS"

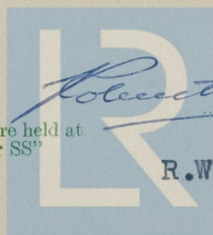

© 2021

Surveyor to Lloyd's Register of Shipping
R.W. Stonehouse & J. Alday

Foundation

011047 011056-0215 2/2