


Bk. "Ann Wilson" 431 Tons built  
in the United States in 1854.

Surveyed by Mr. Bateman at Cardigan  
and recommended for  $\frac{7}{12}$  1. in Red

From the First Entry Report of this  
vessel it will be seen that she  
would have been entitled to the  
4 years grade only when new; she  
is now 17 years old.

As before stated the Rules. Secs 57<sup>63</sup> and  
the Second Survey of Sec 60 have not  
been fully complied with; Mr.  
Bateman in his Report of Survey states  
that "Several treenails have been bored  
out" Sec: 60 requires all the treenails  
to be removed in one stroke of topsides  
all fore and aft on both sides, one  
treenail to be driven out from every alternate  
frame between the upper edge of wales and  
the light mark, and at such other parts  
of the topsides and bottom as the Surveyors  
may direct. I am therefore of opinion  
that the fastenings have not been  
thoroughly examined in accordance  
with the Rules - and I am at a  
loss to know on what grounds Mr.  
Bateman recommendation of  $\frac{7}{12}$  1.  
in Red, is based.

16/11/71

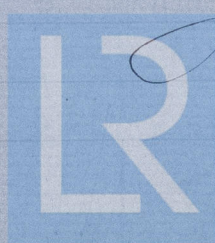

© 2021

Lloyd's Register  
Foundation